

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY &
 REMONUMENTATION

NOV 02 1999

SECTION

corners in Washtenaw (County) Located In: Corner Code #

Public Land Survey T2S R5E K-3


Property Controlling in Section S T R

Miscellaneous S T R

Property in Section S T R

Lot No. _____, Recorded Plat _____

Private Claims _____



5017332
 Page: 1 of 2
 02/25/1999 02:59P
 Peggy M. Haines - Washtenaw Co. CORREM L-2 P-228
 - Copy -
 Register of Deed Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

Thomas L. Sutherland, in a field survey on November 21, 1998 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Registered Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A. Description of original monument and accessories and/or subsequent resortation:

- G.L.O. Field Notes
- 1) 12" W.O. N83°W 25 Links
 - 2) 16" B.O. S80°E 16 Links

(Continued on Other Side)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Found triangular concrete monument in North-South fence line in southeasterly side of pipeline easement 1.8' above ground with "x" chiseled on cap. Monument had been hit on the N.E. side and was leaning to the S.W. Top 3" of monument was broken off but was still sitting on top. Dug down 2' to bottom monument and plumbed monument up. Rocks taken from base of monument were replaced in backfill. Epoxied top 3" back on monument and epoxied remon tag over "x" on top of monument.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Triangular concrete monument with remon tag epoxied over chiseled "x" on top of monument.

- 3) 13" Hickory S25°E 16.84 to W.C.R.C. tag on E side
- 4) 20" Stump South 12.95 to W.C.R.C. tag on E side
- 5) 4" Steel post (badly damaged) North 14.2
- 6) 12" Hickory S85°E 45.12 to W.C.R.C. tag on N side
- 9) 8" Twin Cedar S85°W 56.16 to W.C.R.C. tag on S side
- 10) 14" Elm N05°E 58.10 to W.C.R.C. tag on E side
- 11) 12" Twin Hickory N85°E 54.67 to W.C.R.C. tag on S side

PROVED
 DATE 12-14-98
 REP. fx

I conclude that after careful study of the record documentation and field observation, that this corner is accepted as the best available evidence of the position of the original corner.

Signed by: Thomas L. Sutherland Date 12-21-98
 Surveyor's Michigan License No. 26420

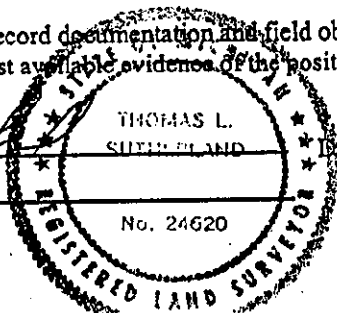

COPY

A. (Continued from Front)

H.H. Atwell Grid Book and Atwell Hicks Composite Drawings
207-70, 207-87, and 207-41. Triangular Monument 24" ± above ground

SURVEY &
REMONUMENTATION

NOV 02 1999

Atwell-Hicks, H. Taft #12032 6/18/73 Dwg. 507-34, 9/14/73 L.C.R.C. L3, P255;
J. Snyder #13352 8/4/78 Dwg. 507-88; 4/26/85 Dwg. 507-133
Triangular Concrete Monument 2.5' above ground

- 3) 8" Hickory S25°E 17.2
- 4) 10" Oak South 13.0
- 5) 3" Steel Post (green and white) North 13.8
- 6) 10" Hickory S85°E 46.5



Roskelly, Jekabson, I.J. Jekabson #19836
Dwg. 787-208-A
Concrete Post

- 3) 8" Hickory S25°E 17.2
- 4) 10" Oak South 13.0
- 6) 10" Hickory S85°E 46.5
- 5) 3" Steel Post North 13.8

Washtenaw Engineering, N. Fahrner #17620
Field Notes from Survey dated 9/1/81
Concrete Monument with "x" on top in North-South fence

- 3) 8" Hickory S30°E 17.30 to Nail
- 4) 12" Oak S'y 13.01 to Nail
- 7) 4" Pine S40°W 8.83 to Nail
- 8) Metal Gas Marker N'y 15.7

Atwell-Hicks R. Timmons, #23319 Dwg. 107-60;
R. Macomber #27453 Dwg. 507-150;
J. Snyder #13352 7/10/87 Dwgs. 507-155, 507-156 and 507-155; 8/12/87
Dwgs. 507-158 and 507-159;
J. Jagow Jr. #33137 6/15/88 Dwg. 507-171

- "x" on Triangular Concrete Monument
- 3) 8" Hickory S25°E 17.2 (P.K. East side)
 - 4) 10" Oak South 13.0
 - 5) 3" Steel Post Marker North 13.3
 - 6) 10" Hickory S85°E 46.5