

55

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Schoolcraft

Located In:

Corner Code #

(County)

1. Public Land Survey

T 46N R 13W

M1

T 46N R 13W

M2

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Aug 24 1995

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

(M1) Corner common to townships 46N-47N, Ranges 12W-13W. Corner reestablished by double proportionate measurement in 1956 by Billy D. Buckler. 1" pipe with 4" brass cap. 36" W. Pine stub S56E 242 links, 30" W. Pine stub S05W 188 links.

(M2) Quarter corner common to Section 6 T46N-R12W and Section 1 T46N-R13W. Corner established in 1841 by Wm. A. Burt: 40.00 Set qr. Sec. post, Beech 5 S54E 19, Beech 5 N63W 18.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(M1) Recovered the 1956 monument as described, in good condition, and at record bearing and distance from the two W. Pine stub witnesses. Left the monument in place and marked four new bearing trees as described below. This corner is being recorded in order to update the accessories.

(M2) Original post and accessories not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner on a straight line between Section corner 2664.55 ft. south and township corner 2615.93 ft. north, being proportionate to the original record. At the position for the corner, I placed a 1"IDx36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet appropriately stamped. I found a 1/2" re-rod nearby, apparently placed by an adjacent landowner. It's position is noted below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.


(M1) Found 1" iron pipe with 4" brass MI DEPT. OF CONSERVATION cap. Blazed, scribed, and set measuring nails in the following:

4" Aspen S12E 5.4' "S6 NBT"
10" J. Pine N89W 34.1' "S36 NBT"
10" J. Pine N15E 24.6' "S31 NBT"
3" Aspen N47E 7.1' "S31 NBT"

Bearings are magnetic.

(M2) Set 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following:

10" Cherry N20E 33.3' "1/4S NBT"
8" W. Pine S73N 23.35'
5" W. Pine W59W 44.7'
6" W. Pine N43N 60.4'
Found 1/2" re-rod S06W 28.56'
Placed a 5" squared and scribed cedar post adjacent. Bearings are magnetic.

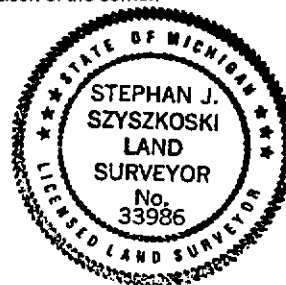

Signed by

Stephan J. Szyszkoski

Date

11-29-95

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division