

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Baraga (County)	Located In:	Corner Code #
1. Public Land Survey	T 51N R 32W	H9
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S 22 T 51N R 32W	16
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. , Recorded Plat		
5. Private Claims		

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Stephan J. Szyszkoski, in a field survey on H9 03/21/2011 do hereby state  
that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2  
above were in conformance with regulations and rules therefore as required in the current manual of survey  
Instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of  
a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with  
the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established,  
re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded  
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(H9) Quarter corner common to Sections 22 and 27. 1986 - Reestablished by Stephen D. Douglas,  
Cadastral Surveyor, for the U.S. D.O.I., Bureau of Land Management, in a dependent resurvey of this  
township. Reestablished at proportionate distance along the Section line between Section corners  
39.864 chains east and west. The position was not monumented.

(16-Sec. 22) East 1/16 corner between Sections 22 and 27. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H9) Reestablished the 1986 position midway and on the Section line between Section corners 2630.91'  
(39.862 chains) east and west. The position for one of the controlling Section corners, G9, is not  
monumented: Its position was computed by proportionate measurement to the dimensions given on the  
1986 Plat of Resurvey between Quarter corners G8, F9, G10, and Section corner I9.

(16-Sec. 22) Established the corner midway and on the Section line between Section corner 1315.46'  
east and Quarter corner 1315.46' west. From the position for the corner, I found a 3/4" iron pipe,  
not of record, N09E 16.5', not accepted as marking the position for the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


(H9) Set 1"IDx32" I.pipe with 4" alum. MDNR cap.  
Set measuring nail with MDNR tag in the side of:  
4" Ironwood N16E 12.75' mrkd "1/4S NBT"  
4" Sugar S76E 21.7' do  
8" Sugar S30W 6.75' do  
5" Y.Birch S78W 5.95' do  
Set sq'd Cedar post adjacent.  
Bearings are magnetic.

(16) Set 1"IDx32" I.pipe with 4" alum. MDNR cap.  
Set measuring nail with MDNR tag in the side of:  
5" Maple N30E 20.35' mrkd "1/16S BT"  
4" Maple N75E 1.0' do  
4" Sugar S46W 10.05' do  
5" Hemlock N60W 2.05' do  
Set sq'd Cedar post adjacent.  
Bearings are magnetic.

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 08/30/2011

For the Michigan Department of Natural Resources, Forest Management Division

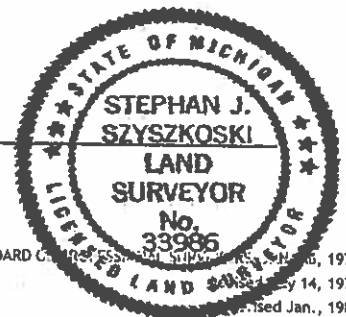

16710

16711