

For corners in
Chippewa

(County)

Located In:

Corner Code ~~##~~

- Register of Deeds Stamp & File Number**

I, Stephan J. Szyszkoski, in a field survey on _____, 19____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


(F5) Quarter corner common to Sections 9-16. Established in 1845 by John Mullett: "...39.95 Set qr. section post. Cedar 10 S56E 16, Cedar 8 N87W 13." Corner noted in Field Notes of Survey by County Surveyor F.H. Brown for Desermeau and Munoskong Club, 1912 and July 1915: "The 1/4 post on N side was set by mistake 7.5 ft too far east. Set W. 1/8 line to run 3960 from east line but told him to move 12 ft east at N 1/8 post". Brown shows distances along the north line of section 16 as follows: from the NE corner west, 1320, 1320, 1320. Ronald Bischer. PS told me that during a survey he did in 1992 or 1993, he found an iron at this corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(F5) Original post and accessories were not recovered. Recovered a 1/4" rebar or spike at the intersection of an old fence line to north and the centerline of an E-W trail road. Nearby witnesses with Bischer's tags face this rebar. My measurement of the north line of Sec. 16 shows that the rebar is 2.8' east and 6.6' north of the original position, proportioned. I accepted the rebar as the best available evidence of the position of the original corner and drove over the top of it a 1" ID x 36" iron pipe capped with a yellow plastic cap stamped "MICH DNR PS 33986".

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(F5) Set 1" pipe with plastic MDNR cap.
Set measuring nails with MDNR tags in
the following:
fence post N24W 37.4'
fence post N06E 60.6'
fence post South 27.5'
fence post S28W 30.9'
Bearings are magnetic. Distance are to
the measuring nails.

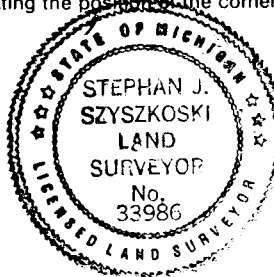

Signed by

Date _____

Surveyor's Michigan License No. _____

No. _____
For the Michigan Department of Natural Resources - Forest Management Division

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
Management Division
REVISED MAY 14, 1975
REVISED JAN. 1983