

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Chippewa Co.

Three Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>45</u> N. S., R. <u>1</u> E. W.	L-5 K-6 J-5
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 6/19 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

Corners set by James H. Mullett D.S. in 1845.

- L-5  $\frac{1}{4}$  Cor. bet. Sec's. 12-13. Bearings were: Maple 20, N10°W, 27 lks.  
Fir 6, S3°E, 4 lks.
- K-6  $\frac{1}{4}$  Cor. bet. Sec's. 13-14. Bearings were: Birch 20, N85°W, 6 lks.  
Birch 8, S59°E, 13 lks.
- J-5  $\frac{1}{4}$  Cor. bet. Sec's. 11-14. Bearings were: Fir 6, N21°W, 38 lks.  
Fir 4, S44°E, 21 lks.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- L-5 Re-established corner midway and on line bet. two section corners.
- K-6 Re-established corner midway and on line bet. two section corners.
- J-5 Placed by extending a line from NE section corner 14, thru a post found at East 1/16 corner, on northside of section 14. Distance agrees with a distance of an old record by unknown surveyor, found in County Courthouse.


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Placed at all corners 1" x 36" pipe with Dep't cap.

- L-5 New bearings: 5" Soft Maple, S82°W, 27.2'
- K-6 New bearings: 14" R. Maple, N10°E, 59.0' and 20" R. Maple, S35°E, 32.0'
- J-5 New bearings: 8" R. Maple, N5°E, 22.6' and 8" R. Maple, S63°W, 23.2'

SIGNED BY Billy D. Buckler DATE 7/30/74

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

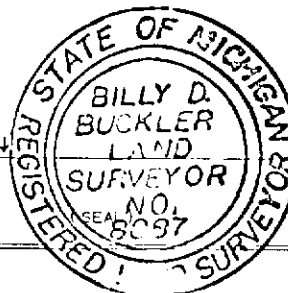

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

(SFAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_