

MAR OS 1994

Chippewa County Remonumentation Corner

RECEIVED FOR RECORD CHIPPEWA COUNTY STATE OF MICHIGAN

Octavity of the

3. Miscellaneous

expressed below:

Property in Sec.

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 93 DEC 29 AM 10: 27


For corners i	n			,
Chippewa (County)		Located In:	Corner Code ##	
1. Public La	and Survey	T 46N R 1E	I-13 SAME I-1 CORNER	RE
		T R T R		
2. Property in Section	Controlling	S R S T B		

Register of Deeds Stamp & File Number

_____, Recorded Plat ___ 5. Private Claims _

Larry R. Rogers , in a field survey on November 12 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

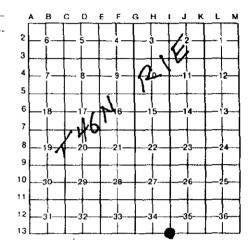

A. Description of original monument and accessories and/or subsequent restoration:

(I-13) Section Corner Common to Sections 34 & 35, T46N-R1E and Sections 2 & 3, T45N-R1E

This corner was previously recorded in 1982 by W.L. Karr in Liber 5, Page 218 of the Chippewa County corner Records as a 1" iron pipe in road intersection with the following witnesses:

Northeast House Corner N27°W 101.90' N57°E Utility Pole 58.21' S61°W Northeast House Corner 58.90'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

The Chippewa County Road Commission placed a monument box over pipe during reconstruction of Riverside Drive. Found mangled pipe in monument box and replaced it with a 3/4" x 24" iron pin. Corner position checks with three witnesses from $\frac{1}{4}$ $\frac{$ 1982 record. Accepted position and established one new witness.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: (I-13) Corner is a 3/4" iron pin in monument box in centerlines of Riverside Drive and Twelve Mile Road.

Witnesses: Northeast House Corner N27°W 101.884 Northeast House Corner S61°W 58.98' N57°E Utility Pole (DR1/76E/8) 58.23' 12" Spruce S38°E 150.39'

OF MICHICAL LARRY R. ROGERS Land Surveyor NO. 29251 NSEO LAND

Signed by ___

Date 30 NOV 1993

Surveyor's Michigan License No.

NOTE: Bearings are compass bearings corrected for declination.

REVISED MAY 14, 1975 REVISED MAY 14, 1975 REVISED JAN., 1983 Distances are to a nail in side of witness objects unless noted.