1899 LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Chippewa County Remonumentation Corner \$7.00 LAND CORNER

SECTION For corners in

\$2.00 MSSR

21 JAN 1999 11:09:52 AM Receipt #13123 RECEIVED FOR RECORD

CHIPPENA COUNTY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 10 PAGE 376


Register of Deeds Stamp & File Number

Located In: Corner Code # Chippewa 1. Public Land Survey L/M-13 🖍 L/M-1 R 2. Property Controlling in Section 3. Miscellaneous Property in Sec.

____, Recorded Plat Private Claims

I. Larry R. Rogers, in a field survey on December 18, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

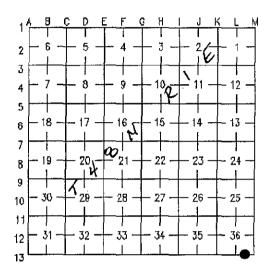

A. Description of original monument and accessories and/or subsequent restoration:

(L/M-13) Meander Corner on South line of Section 36, Town 48 North, Range 1 East.

Original post was placed by John Mullett in 1845. Corner was used in a 1917 survey by County Surveyor F.H. Brown. In 1981 Harry Goodwin set W.C.M.C. 1431.4 feet West of Township corner. In 1984 William L. Karr, P.S. 27450 found 1" iron bar approximately 1831 feet North of Goodwin iron. 1" iron bar works very well with other corners recovered from 1917 "Brown" survey. Goodwin iron was disregarded and a "iron bar was accepted as meander corner. Corner has since been used in surveys by several other surveyors.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(L/M-13) Meander corner on South line of Section 36, Town 48 North, Range 1 East.

This corner is being perpetuated by the Chippewa County Remonumentation Program.

Found no evidence of original corner. Found 1" iron bar used by Karr, 45.2 feet East of apparent position of original corner. distance East to Township corner. Distance from Township corner to found meander corner is 15.8 feet longer that Brown's 1917 survey indicates, (1452 feet G.L.O., 1406.8 feet Karr, 1389 feet Brown). Accepted corner position as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: (L/M-13) Witness Corner to Meander Corner on South line of Section 36, Township 48 North, Range 1 East. Corner is a 1" solid iron bar, 25 feet more or less East of water's edge of St. Mary's River.

Witnesses: 9" Ash N24°E 55.30 feet 6" Spruce N85°E 98.14 feet 1/2" iron pin S86°E 68.12 feet 1406.8 feet Township Corner East Anchor Pole 64.99 feet S61°E Goodwin Iron S38*W 41.16 feet 2.0 feet Steel Fence Post West



Signed by

30 Dec 1998 __ Date ____

Surveyor's Michigan License No: 29251

NOTE: All bearings are compass bearings corrected for declination (6°W). All distances are to a nail and tag in the side of witness object unless otherwise noted.