

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
(County)

Located In:

Corner Code #

1. Public Land Survey

T 44N R 28W G11
T R
T R
T R

2. Property Controlling in Section

S 34 T 44N R 28W 1
S T R

3. Miscellaneous Property in Sec.

S T R
S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

G11 May 27 1999

1 Dec 15 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(G11) Corner common to Sections 27-28-33-34. Remonumented in 1952 by Dean C. DeLaMater RLS in the original position, according to an original B.T. Original bearing trees: Tamarack 8 S36W 19, Tamarack 8 N27E 32.

(1-Sec. 34) West 1/16 corner between Sections 27-34. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G11) Recovered the 1952 monument, a 1" iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, a scribed and squared wooden post, the 1952 accessories, the rotting stump remains of the original bearing trees, and an old post point, laying on the ground, adjacent to the scribed and squared post. The 1952 witnesses and the original 81 stumps were all found at record bearing and distance from the scribed and squared post. Inexplicably, the 1952 monument was found 2.5' distant. I removed the 1952 monument and placed it at the position of the post and in accord with the accessories of record.

(1-Sec. 34) Established the corner midway and on a line of mean true bearing between Section corner 1320.31' west and Quarter corner 1320.31' east. At the position for the corner I placed a 1" IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G11) 1" pipe with 4" brass cap.

(1) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

Blazed and scribed the following:

9" Cedar N54E 6.9' "S27 NBT"

5" Spruce N28E 23.6' "1/16S BT"

11" Cedar S10E 20.4' "S34 NBT"

6" Spruce S71E 17.1' do

11" Cedar S76W 33.2' "S33 NBT"

7" Spruce South 10.3' do

The 1952 wits:

6" W. Pine N38W 7.8' do

10" 8.Spruce N41W 15.8' notch visible


2.5"x2.5"x3' angle iron post adjacent.

14" Cedar S24W 12.1' notch visible

Bearings are magnetic. Distances are to

Bearings are magnetic. Distances are to notch in lower blaze.

notch in lower blaze.

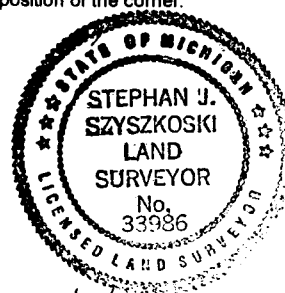

Signed by

Surveyor's Michigan License No.

33986

Date

3/7/00

For the Michigan Department of Natural Resources - Forest Management Division