

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Dickinson

(County)

Located In:

Corner Code #

**1. Public Land Survey**

T 44N R 28W

A4

T 44N R 28W

E11

T R

T R

**2. Property Controlling in Section**

S

T R

S

T R

**3. Miscellaneous Property in Sec.**

S

T R

S

T R

Register of Deeds Stamp & File Number

**4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_**

**5. Private Claims \_\_\_\_\_**

E11 May 27 1999

A4 May 25 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

(A4) Quarter corner common to Section 7 T44N-R28W and Section 12 T44N-R29W. Reestablished in 1963 by Billy D. Buckler, RLS. 1" iron pipe with 4" aluminum cap. 30" W. Pine stump N86E 26 links, 20" W. Pine S63W 87 links.

(E11) Corner common to Sections 28-29-32-33. Remonumented in 1952 by Dean C. DeLaMater RLS in the original position according to an original B.T. 1" pipe with 4" brass cap. 5' Spruce S56E 45 links, 5' Spruce S10W 30 links.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(A4) Recovered the 1963 monument, a 1" ID iron pipe capped with a 4" dia. cast aluminum Michigan Dept. of Conservation tablet, in good condition, at record bearing and distance from the remains of the two 1963 accessories. The W. Pine stump NE is rotting away and the W. Pine SW is now dead, standing, and has scribing visible. Left the monument in place and marked new witnesses as described below.

(E11) Recovered the 1952 monument, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition, at record bearing and distance from the remains of the 1952 witnesses, both dead and down. Left the monument in place and marked new accessories as described below.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(A4) 1" pipe with 4" aluminum cap.

Blazed and scribed the following:

9" R. Pine N37E 17.3' "1/4S N8T"

7" R. Pine S47E 6.9' do

8" Maple S06W 29.7' do

8" R. Pine N58W 20.4' do

Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

(E11) 1" pipe with 4" brass cap.

Blazed and scribed the following:


8" B. Spruce S04E 59.9' "S33 NBT"

4" B. Spruce S20W 58.6' "S32 NBT"

4" B. Spruce S76W 62.4' "S32 NBT"

8" B. Spruce N76W 39.6' "S29 NBT"

Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

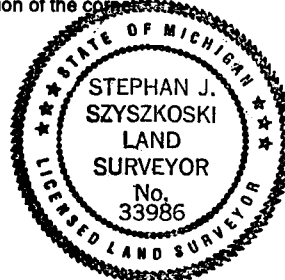

Signed by

Stephan J. Szyszkoski

Date

3/7/00

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division