

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located In:

Corner Code #

**1. Public Land Survey**

T 44N R 28W J11

T R

T R

T R

**2. Property Controlling in Section**

S 26 T 44N R 28W 14

S T R

**3. Miscellaneous Property in Sec.**

S T R

S T R

Register of Deeds Stamp & File Number

**4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_**

**5. Private Claims \_\_\_\_\_**

14 Dec 15 1999

J11 Nov 04 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

(J11) Quarter corner common to Sections 26-35. Established in 1850 by John Burt: "39.95 Set Cedar Quarter Section Post. Cedar 14 S48E 20, Cedar 14 N50W 6."

(14-Sec. 26) South 1/16 corner between Sections 25-26. Corner not established in the original survey. Found no subsequent record.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(J11) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 2627.61' east and west. At the position for the corner I placed a 1" IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(14-Sec. 26) Established the corner midway and on a line of mean true bearing between Quarter corner 1324.59' north and Section corner 1324.59' south. At the position for the corner I placed a 1" IDx32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(J11) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

4" Spruce N68E 133.35' "1/4S NBT"

8" Sugar S88E 127.15' do

9" Spruce S54E 125.35' do

10" Sugar N15W 262.15' do

Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

(14) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:


7" W.Spruce S20E 38.6' "1/16S BT"

7" W.Spruce S14W 70.6' do

7" Sugar S51W 77.8' do

6" B.Spruce N01W 38.2' do

Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

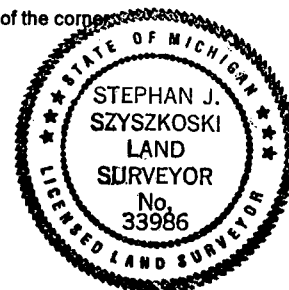

Signed by

Stephan J. Szyszkoski

Date

3/7/00

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division