

JAN 19 2001

SECTION

Re-Mon Libew 2, Page 10

2000 REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in BINGHAM Township

Huron
(County)

Located in: Corner Code #

- 1. Public Land Survey T 15N R 13E A-10
T _____ R _____
T _____ R _____
T _____ R _____
- 2. Property Controlling S
in Section S T _____ R _____
T _____ R _____
- 3. Miscellaneous S
Property in Sec. S T _____ R _____
T _____ R _____

STATE OF MICHIGAN
HURON COUNTY
RECORDED

8 DEC 2000 9:57 AM

FRANCES L. HOLDWICK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

I, Russell L. Brown, in a field survey on June 2, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 1834 G.L.O. H. Parke D.S. Set quarter Section Post, East side Sec. 25, T15N-R12E,
 Hemlock 12 S3W 23, DO 10 N41W 28
 COUNTY SURVEYORS RECORD - None
 COUNTY ROAD COMMISSION RECORDS - Iron Pin WITNESSES: N88°E 52.0' Spike in 15" Poplar, S55°E 67.6'
 L.C.R.C. - None
 RECORDED SURVEYS - None
 UNRECORDED SURVEYS - None

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 No evidence of original corner or accessories found.

Found 3/4" Dia. Re-Rod in Monument Box.

Accepted Found 3/4" Dia. Re-Rod as best evidence of original corner position.

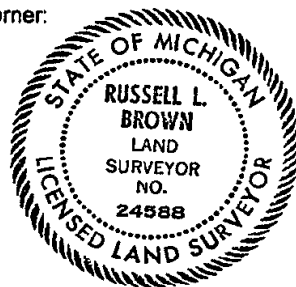

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-10 W. 1/4 Cor. Sec. 30, T15N-R13E
 Found 3/4" Dia. Re-Rod in Monument Box
 WITNESSES:
 N45°E 48.42' to P.K. Nail in S. W. Side Wood Gate Post
 N80°E 39.92' to P.K. Nail in N. W. Side Wood Gate Post
 S60°E 66.93' to Spike and Bottle Cap in N. Side 30" Cottonwood Tree
 S75°E 18.63' to 1/2" Dia. Re-Rod Reference Iron Set
 South 2636.96' A-11, S.W. Cor. Sec. 30, T15N-R13E
 North 2649.21' A-9, N. W. Cor. Sec. 30, T15N-R13E

NOTE:
 This Corner is Common with
 M-10, T15N-R12E

Signed by Russell L. Brown
 Surveyor's Michigan License No. 24588

Date Nov. 2, 2000

Peer group approved at meeting held November 2, 2000. RLB