

## 2000 REMONUMENTATION

*Re-Monumented, Page 96*

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For Corners in

Huron  
 (County)

Located in:

Corner Code #

 STATE OF MICHIGAN  
 HURON COUNTY  
 RECORDED

29 NOV 2000 11:22 AM

 FRANCES L. HOLLOWICK  
 REGISTER OF DEEDS

Register of Deeds Stamp &amp; File Number

1. Public Land survey: Brookfield T 15\_N\_R 10\_ET      R     T      R     T      R     2. Property Controlling  
in SectionS      T      R     S      T      R     3. Miscellaneous  
Property in Sec.S      T      R     S      T      R     4. Lot No.                 , Recorded Plat                 5. Private Claims   

SECTION

I, James T. Meek, in a field survey on October 1, 2000

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:  
 Original survey, West Bdy. T15NR10E, 1835, Harvey Parke D.S.

A-7 Corner of Sections 18, 19

Post

Birch 9", S36°W, 20 links

B. ash 10", N22°W, 38 links

County Surveyor's Record: ¼" iron, cedar

Recorded Surveys: L4, P311 (Case); L4, P620

(Case); L1, P610 (Case)

LCRC: none

A-8 West ¼ Corner of Section 19

Post

Birch 10", S21°W, 16 links

Elm 22", N53°W, 11¼ links

County Surveyor's Record: ¼" iron wood post

Recorded Surveys: L1, P610 (Case); L3, P389

(Brown); L3, 690-691 (Brown)

LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-7 Corner of Sections 18, 19

Found ¼" iron in mon box

5' South of intersection of Bay Port &amp; Rescue Roads

Accepted as the best available evidence  
 of the original corner position.

A-8 West ¼ Corner of Section 19

Found 1" iron in mon box

1' East of centerline of Bay Port Road  
Occupation lines bear East & West

Accepted as the best available evidence  
 of the original corner position

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-7 Corner of Sections 18, 19

¼" iron in mon box

From which:

Road sign post bears N50°E, 44.15'

Tag in power pole bears S45°E, 60.7'

Road sign post bears S60°W, 33.1'

¼" iron bears N45°W, 36.0'

A-8, ¼ Corner of Section 19 bears

S0°06'37"E, 2636.55'

A-6, ¼ Corner of Section 19 bears

N0°07'51"W, 2635.34'

A-8 West ¼ Corner of Section 19

1" iron in mon box

From which:

Tag in power pole bears N20°E, 120.6'

Tag in power pole bears S80°E, 29.15'

Tag in power pole bears S20°E, 111.3'

Wood post bears West, 36.35'

A-9, Corner of Sections 19, 30 bears

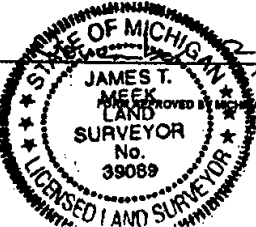
S0°02'59"W, 2632.40'

A-7, Corner of Sections 18, 19 bears

N0°06'37"W, 2636.55'

 Signed by James T. Meek  
 Surveyor's Michigan License No. 39089

Date

APPROVED AT PEER BOARD MEETING 11-02-00 RJB
 REVISED MAY 14, 1975  
 REVISED JAN. 1983  
 REVISED OCT., 1995