

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Iron (County)	Located In:	Corner Code #
1. Public Land Survey	T R	
	T R	
	T R	
2. Property Controlling in Section	S 19 T 43N R 32W	1
	S T R	(GCDB 120400)
	S 19 T 43N R 32W	3
3. Miscellaneous Property in Sec.	S T R	(GCDB 100360)
	S T R	
4. Lot No. _____, Recorded Plat		
5. Private Claims		

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

I, Stephan J. Szyszkoski, in a field survey on 12/22/15 do hereby state
that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2
above were in conformance with regulations and rules therefore as required in the current manual of survey
instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of
a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with
the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established,
re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(1-Sec. 19) West 1/16 corner between Sections 18 and 19. The US plat gives dimensions of 20.00
chains east to 1/4 cor. B7 and 20.09 chains west to Section corner A7.

(3-Sec. 19) North 1/16 corner between Section 19 T43N-R32W and Section 24 T43N-R33W. Found no
record of prior monumentation.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(1-Sec. 19) I found a 5/8" rebar, 1322.45' west of B7 and 1328.27' east of A7, substantially at the
proportionate record position and accepted same as a careful and faithful establishment of the
position of the corner. From this position, I found a 1" ID I.pipe 3.16' west, substantially midway
between corners A7 and B7, and not accepted as marking the position for the corner.

(3) Found a 1" ID I.pipe set 7" below the surface of a gravel driveway and substantially at a
position midway and on line between corners A7 and A8. Accepted same as a careful and faithful
establishment of the position of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(1) Drove a 1"IDx28" I.pipe with 2" alum. MDNR cap
over found 5/8" rebar. Set measuring nail with MDNR
tag in the side of:
Power pole 1653 N33°E 20.3'
7" R.Pine S61°E 15.75' mrkd "1/16S BT"
17" R.Pine S25°E 11.15' do
14" R.Pine S64°W 7.25' do
Set sq'd cedar post adjacent.
E= 7894727.590 N= 148992.763


(3) Found 1"ID iron pipe 7" below surface.
Set measuring nail with MDNR tag in the side of:
17" R.Pine N75°E 10.68' no blaze or scribing
15" R.Pine S55°E 15.63' do
15" R.Pine N39°E 33.8' do
Power Pole N39°W 77.05'
E= 7894316.912 N= 148598.155

Bearings are magnetic. Coordinates are MCS83 in meters, NAD83(2011) Epoch 2010.00 datum.
Coord. Ref. (adjusted)=NGS PID AA8081: E= 7895147.463m N= 147176.691m

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 01/28/2016

For the Michigan Department of Natural Resources, Forest Resources Division

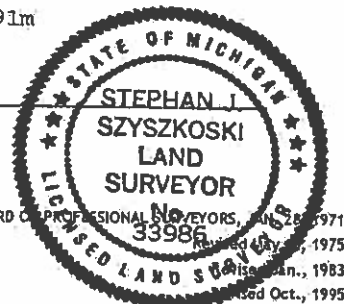

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN 28, 1971
Revised by 1975
Revised by 1983
Revised Oct., 1995