

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron

(County)

Located in:

Corner Code #

1. Public Land Survey

T 44N R 31W

J7

2. Property Controlling
In Section

S

T

R

3. Miscellaneous
Property in Sec.

S

T

R

S

T

R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Jun 30 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(J7) Quarter corner common to Sections 14-23. Corner established in 1849 by John Burt: "Set Spruce Gr. Sec. post. Y. Birch 20 N25W 16, Spruce 10 S65E 19". Corner shown on map prepared for Wisconsin-Michigan Power Company by Holland, Ackerman and Holland rev. 12/7/53, aspl G-154-66, titled "Michigan River-Way Storage Dam Land Ties and Benchmarks". Corner is noted as "set iron pipe and replaced with square concrete monument with brass cap, 8" poplar S78W 9.2', 8" W. Pine N35E 54, 5" W. Pine S61E 52.6'".

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J7) Original post and accessories not recovered. Found a 7" square concrete monument with a square brass WMPCO tablet, in good condition, appropriately stamped. I also recovered a 3/4" iron pipe, apparently that noted above, due west 7.0' from the monument. The pipe falls at record bearing and distance from the WMPCO witnesses, which were recovered (the poplar is now just a stump hole). Based on the MAH map noted above, it was common practice to place pipes at the corner positions and then replace them with monuments. I can only speculate that the corner position in this case was refined by MAH subsequent to the placement and witnessing of the pipe, and that the true corner position was monumented with the WMPCO concrete monument as recovered. From the concrete monument, distance west 1.00 chain to foot of hill C. NE checks with the original record. Distance east to monumented Section corner (2659.9') is consistent with other lines measured in this part of the township. I accepted the WMPCO monument as the best available evidence of the position of the original corner. Left the monument in place and made new witnesses as described below. Corner witnessed by B. Wheeler and D. Lampela, Baraga District Office, MDNR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J7) Found WMPCO concrete monument.

Blazed and scribed the following:

8" R. Pine N41E 27.2' "1/4S MBT"


8" R. Pine S51E 8.6' "1/4S MBT"

8" R. Pine S07W 13.8' "1/4S MBT"

6" Spruce N62W 11.3' "1/4S MBT"

Placed a squared spruce post adjacent.

Bearings are magnetic.

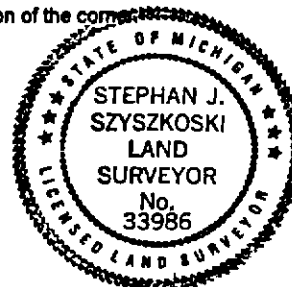

Signed by

Stephan J. Szyszkoski

Date

Sept. 8, 1997

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division