

SURVEY & REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

JAN 25 2001

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

RECORDED
LAKE COUNTY, MI.

LIBER 004 PAGE 0249

MAY 5 10 27 AM '00

Shirley Myers
REGISTER OF DEEDS

SECTION
For corners in
Lake _____

Located in: Corner Code#

1. Public Land Survey T 17 N R 14 W C-1
T R
T R
T R
2. Property Controlling in Section S T R
S T R
3. Miscellaneous Property in Sec. S T R
S T R
4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

Register of Deeds Stamp & File Number

I, Robert L. Wetherell, in a field survey on March 10, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

C-1 - Sec. Corner common to Sections 5 & 6, T17N, R14W

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

1838 - J. Hodgson, G.L.O.

#1 - 6" Hemlock S43°E 18 Links
#2 - 4" Hemlock S64°W 23 Links

1914 - G.H. Johnson, Co. Sur.

#3 - 7" B. Oak N84°E 223 Links
#4 - 9" Hemlock S85°W 152 Links

1951 - G. Blass, LS 5489

"Set corner 10.56 feet East of the standard corner on the township line". The standard corner was identified by a local resident. (corner set was a 3/4" bolt)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a 3/4" Iron 10.55 feet East of a 5" Square Concrete Monument (corner of Sections 31 & 32, T18N, R14W). Corner is 5 feet East of the centerline of North and South road and in the centerline of a road to the East. It is in line with an old fence to the West.

Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found 30" R. Oak, #4 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the found 3/4" bolt with a 3/4" x 24" rebar with Lake County Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

Concrete Monument - West 10.55' (Cor. common to Sec's 31 & 32, T18N, R14W)

P. Pole N43°E 38.59' (PK in S.E. side)


24" W. Pine S81°W 62.05' (60d spike in N. side)

Guy Pole N48°W 48.66' (60d spike in N.E. side)

13" Ash S63°E 70.96' (60d spike in S. side)

5" W. Pine N48°W 93.10' (60d spike in S. side)

RATIFIED BY THE LAKE CO. DEED REVIEW GROUP
IN ACCORDANCE WITH P.A. 345
CHAIRMAN R.L.W.
DATE 4-11-2000

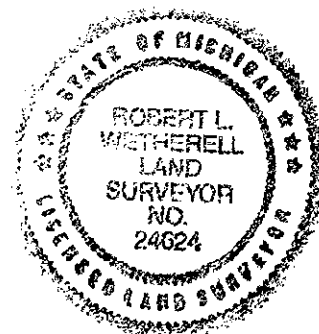

Signed by Robert L. Wetherell
Surveyor's Michigan License No. 24624

Date 4-12-2000