

SURVEY &
REMONUMENTATION

APR 28 1995

COMMISSION

1994 REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED FOR RECORD

94 DEC 22 PM 2: 03

LIBER NO. 05 PAGE NO. 179

Robert D. Stough
REGISTERED PROFESSIONAL
LAND SURVEYOR - MICHIGAN

For corners in MARATHON TWP.

LAFEEER

(County)

Located In:

Corner Code #

1. Public Land Survey

T 09N R 09E

M-6

T R

T R

T R

T R

2. Property Controlling
in Section

S

T R

S

T R

3. Miscellaneous

S

T R

Property in Sec.

S

T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Register of Deeds Stamp & File Number

I, JONATHAN M. FIELD, in a field survey on SEPTEMBER 23 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1852 GLO; WAMPLER, D.S.; SET 1/2 MILE POST; BEECH 7 N13W 44LKS., BEECH 11 S47W 27LKS.

1906 SICKLESTEEL, C.S.; STAKE; PINE STUMP 33 N58E 22LKS., PINE STUMP 36 S30W 46LKS.

1988 HENDERSON-BATES; ELRICH, P.S.#18986; SURVEY L.8, PG.61; FND 1/2" IRON; S80°W 8.96' 6" CHERRY, S75°E 23.75' 24" HICKORY, N30°E 21.0' 6" CHERRY

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1994 ROWE ENG.; FIELD, P.S.#37276; FND 1/2" ROD AT BASE OF FALLEN ANCHOR POST (FENCE RUNS N-S-W FROM POST) RECOVERED 3 PREVIOUS WITNESSES INDICATING THAT FND IRON IS IN SAME POSITION AS 1988 HENDERSON-BATES SURVEY

2618.59' M-6 TO M-7 (MEAS. BY OTHERS)

ACCEPTED 1/2" ROD AS A CAREFUL AND FAITHFUL PERPETUATION OF THE ORIGINAL CORNER POSITION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-6 SET STANDARD CAP ON 1/2" ROD

S80°W, 8.96' SET NAIL W/ REMON TAG ABOVE FND NAIL IN N. FACE 8" CHERRY

N30°E, 20.94' SET NAIL W/ REMON TAG ABOVE FND NAIL IN NW FACE 6" CHERRY

S75°E, 23.74' SET NAIL W/ REMON TAG ABOVE FND NAIL W/FLAG. IN N. FACE 26" HICKORY

N60°E, 17.89' SET NAIL W/ REMON TAG IN S. FACE 14" WHITE BIRCH

S30°W, 16.73' SET NAIL W/ REMON TAG IN SE FACE 10" CHERRY

S40°W, 18.12' SET NAIL W/ REMON TAG IN NW FACE 12" HICKORY

PEER GROUP
APPROVED LAND CORNER


Signed *Jonathan M. Field*

Surveyor's Michigan License No. 37276

Date 12-8-94

RAY DAVIS, JR. SURVEYOR

DATE 12-22-94

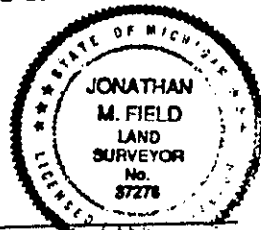

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 16, 1971
REVISED MAY 14, 1975
REVISED JAN. 1983
ADAPTED FOR WORD PROCESSING MARCH, 1983