

JAN 22 2001

SECTION

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee
(County)

Located In:


Corner Code #



LIBER 2

PAGE 13

1. Public Land Survey T-8-S R-3-E H-3
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec S T R

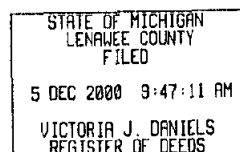

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard in a field survey on October 2, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1824 John Mullett D.S. Set 1/4 Sec. post Hick. 16 S 85 E 44 W. Oak 30 N 40 W 16
 Couldn't find any information prior to the 1956 information by MDOT which calls for iron pipe P.P. N 23° E 21.02
 1957 Kenneth Suydam "Found N 1/4 Cor."
 1975 I found 2" iron pipe and recorded it in Liber 3, Page 349 dbl hd nail & disc in EP N 80° W 159.65 MDOT nail & tag in EP N 20° E 20.96
 1977 I found 2" iron pipe
 1995 I found 1/2" iron pipe which checked the angle that I measured @ the NE corner of Section 10 in 1977 and the distance I measured in 1975

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 2, 2000 I found a 1/2" X 6" iron pipe over a 2" X 35" galv. pipe. The top 12" of the 2" pipe was bent. Cut it off and set it back with 5/8" X 3' re-rod inside. Probed but didn't find anything else. Placed Lenawee County Re-mon cap stamped P.S. 1304 and set monument box in newly laid asphalt.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

dbl hd nail & disc in E.P. N 85° W 159.59
 dbl hd nail & disc in E.P. N 85° E 173.29
 dbl hd nail & re-mon tag in E.P. N 30° E 22.01 (new pole)
 NW corner of conc. block barn foundation S 80° E 335.66
 NE corner of telephone pedestal S 80° W 102.15

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date November 28, 2000

Signed by Glenn E. Richard Date Nov. 29, 2000
 Glenn E. Richard

Surveyor's Michigan License No. 13040