

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Mackinac Co.

3 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>43</u> N. <u>6</u> R. <u>6</u> W.	<u>J-7, L-5, I-3</u>
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 9/14, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
All corners set by H. Brevoort Jr. D.S. in 1845.

J-7 $\frac{1}{4}$ Cor. Bet. Sec's 14-23.	L-5 $\frac{1}{4}$ Cor. Bet. Sec's 12-13.	I-3 Sec. Cor. 2-3-10-11.
Bearings were:	Bearings were:	Bearings were:
B. Ash 12, N6°E, 14 lks.	Pine 12, S66°W, 10 lks.	Spruce 8, S49°E, 10 lks.
Hemlock 8, South, 30 lks.	Birch 18, N50°E, 25 lks.	Tamarack 5, N51°W, 31 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
J-7 Re-established corner midway bet. two Sec. Cors. Found no evidence of original corner.
L-5 Replaced corner from one Pine witness. Corner found by Marcus Schaaf, R.L.S. in 1937.
I-3 Re-established corner by Double Prop. Meas. from corners 2 miles West, 1 mile East, 1 mile North and 1 mile South. Found no evidence of original corner. Corner lies in wet marsh with low Pine ridges.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Placed 1" pipe with 4" aluminium cap at all corners.

J-7 New Bearings:	L-5 New Bearings:	I-3 New Bearings:
14" W. Pine, S67°W, 26.9'.	6" R. Pine, S42°W, 9.9'.	16" W. Pine, S2°E, 16.3
8" R. Maple, N67°E, 71.3'.	12" R. Pine, N11°W, 30.7'.	10" W. Pine, N30°E, 25.8
	14" R. Pine, S65°E, 25.7'.	


SIGNED BY Billy D. Buckler DATE 9/19/77

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

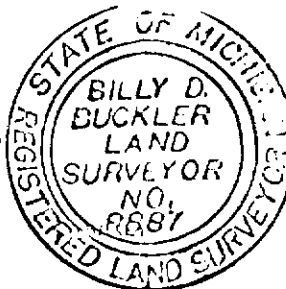

SURVEYOR'S MICHIGAN REGISTRATION NO. _____