

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Mackinac Co.

4 Corners.

FOR CORNERS OF:-	LOCATED IN:-	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>43</u> N. R. <u>12</u> W.	F-7, F-7A Meander Cor. K-6
2. PROPERTY CONTROLLING IN SECTION <u>13</u>	T. <u>43</u> N. R. <u>12</u> W.	3-Sec.13
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 1-13 & 1-15, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Quarter corners set by Guy C. Carlton D.S. in 1849. Bearings were:

- F-7 Beech 10", N53°W, 18 lks. & Beech 14", S59°E, 35 lks. 1/4 Cor. bet. Sec's. 16-21.  
 F-7A Tam 6, S10°E, 63 lks. & Tam 5, N81°W, 1.36 chs. Meander Corner, east of 1/4 cor. bet. Sec's. 16-21, and on West side of Long Lake.  
 K-6 Beech 12, N8°E, 27 lks. & Sugar 15", S30°W, 22 lks. 1/4 Cor. bet. Sec's. 13-14.  
 3-Sec.13 North 1/16 corner on west side of section 13.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- F-7 Restored corner in center of an old N-S grade and in line with sec. cor. to West and Meander cor. to east. Found no evidence of original corner.  
 F-7A Restored Meander cor. by single prop. meas. bet. cors. to east and west. Checks fair with present shoreline.  
 K-6 Restored corner midway and on line bet. two section corners.

3-Sec.13 Placed corner midway bet. sec. cor. to North and 1/4 cor. to South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 Placed 1" pipe with 4" aluminum cap at all corners. Bearings:

- F-7 8" Cedar, N58°W, 33.0' & 10" Cedar, N24°W, 63.7' & 10" Cedar, N31°E, 30.8'.  
 F-7A 8" Cedar, N85°W, 52.0' & 6" Cedar, S57°E, 35.2' & 4" Cedar, S37°W, 24.5'.  
 K-6 12" Cedar, S82°W, 7.4' & 6" R. Maple, N8°E, 35.5'.  
 3-Sec.13 9" Cedar, S86°E, 23.9' & 7" Cedar, N18°E, 25.8' & 7" Cedar, N38°W, 25.7' & Squared a 4" Cedar, 2.0' South of corner.

SIGNED BY Billy D. Buckler DATE 2-11-81

Billy D. Buckler

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

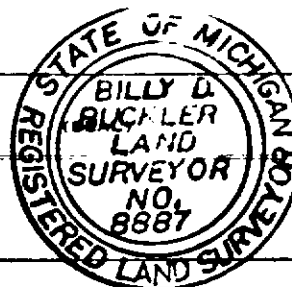

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_