LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Ontonagon		Located in:	Corner Code ≠#
	(County)		Julio Jugo
1.	Public Land Survey	T R	
		T R	
		, T R	
		T R	
2.	Property Controlling	S <u>21</u> T <u>51N</u> R <u>40N</u>	_1
	in Continu	C STT SIND AND	.

Register of Deeds Stamp & File Number


- 4. Lot No.
- 5 Private Claims

3. Miscellaneous

Property in Sec.

August 29, 1994 I, Stephan 1. Szyszkoski..., in a field survey on ... do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5. above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded

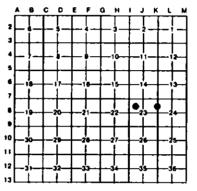

A. Description of original monument and accessories and/or subsequent restoration:

(7-Sec. 23) Morth 1/16 corner between Sections 23-24. Corner not established in the original survey. Corner recorded by Keith i. Sackett in 1977 as follows: "Established on line between section corner north and 1/4 corner south. Set 1° I.D.x5 foot long iron pipe. 4" Maple NOSE 16.4", 5" Maple S60W 24.7", 7" Aspen S26E 12.2". Found no subsequent record.

(4-Sec, 23) Northwest 1/16 corner, Section 23. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(7-Sec. 23) Recovered the 1977, as described, at record bearing and distance from the 1977 accessories. Determined that the 1/4 corner between Sections 23-24, also placed in 1977 by Keith Sackett, is at an erroneous location. This 1/16 corner, being found at the location described in the 1977 record, is, therefore, also at an erroneous location. Established the corner midway and on a straight line between monumented Section corner 1311.68' north and 1/4 corner remonumented this date 1311.68' south. At the position for the corner. I placed a 1"1.0.x32" iron pipe capped with a 4" dia. cast aluminum MDMA tablet, appropriately stamped. From the corner established. I find the 1977 pipe, which projects about 3 feet, to be N56E 6.76' distant.

(4-Sec. 23) Found no evidence of monumentation at the corner postion. Established the corner at the intersection of straight lines connecting apposite 1/16 corners, corners west and south being convented and recorded. The 1/16 corner to the north has been monumented and recorded but has been destroyed. The 1/16 corner east is unmonumented. The unmonumented 1/16's were computed as being midway and on a straight line between adjacent section/quarter corners. At the position for the corner, I placed a 1°I.D.x32° iron pipe capped with a 4" cast aluminum MOMR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(7) Set 1" pipe with 4" MONR cap Blazed and scribed the following bearing (4) Set 1" iron pipe with 4" MDNR cap. Blazed and scribed the following bearing

trees:

7" Maple S62W 17.9' arkd in 1977

trees: 4" Maple M36E 33.8" "1/L6S BT"

- 5" Maple M21E 21.4" mrkd in 1977 8° Aspen \$56E 12.8' mrkd in 1977
- 7° Maple West 10.7° "1/165 BT"
- 5" Maple \$12E 32.6' "1/16S BT"

Bearings are magnetic. The 1977 blazes are overgrown, but scribing is visible.

5° Maple N70E 20.2' "1/165 BT" 5" Ash 526E 3.1" "1/165 BT" 6" Maple \$20£ 36.6" 1/165 81 center of pavement, Morwich road, is West, 32.0'. Bearings are magnetic.

Set a 4" squared maple post adjacent.

SZYSZKOSKI LAND SURVEYOR

STEPHAN J

3<u>3986</u>

Surveyor's Michigan License No.