LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Baraga (County)	_ Located In:	Corner Code #	
1. Public Land Survey	T 48N R 32W	F3 (GCDB 340600)	
2. Property Controlling in Section	T R S T R S T R S T R R R S T R R R S T R R R S T R R R S T R R R S T R R R R		· · · · · · · · · · · · · · · · · · ·
3. Miscellaneous Property in Sec.	S T R S T R	70	
4. Lot No. , Res. 5. Private Claims	corded Plat		Register of Deeds Stamp & File Number
	74, Michigan P.A. of 1970, the corner		
instructions of the United States a Court of Law and /or that the	regulations and rules therefore as require Department of the Interior, Bureau of La corner points mentioned in lines 3, 4 and	and Management or by a decree of 5 above were in conformance with	f 6 -18 -17 -16 -15 -14 -13 -17 -18 -18 -18 -18 -18 -18 -18 -18 -18 -18
the rules of the Michigan Boar re-established, monumented, recov	d of Land Surveyors or by a Decree vered, found as expressed below:	of a Court of Law; established	9
NOTE: Not more than 2 corron this certificate.	ners, all in the same town and range	e, may be recorded	10 30 29 28 27 26 25 11 12 31 32 33 34 35 36
A. Description of original m	nonument and accessories and/or s	subsequent restoration:	13
(F3) Quarter Corner of	common to Sections 4 and 9	. 1975 - The original	l monument and accessories


- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- (F3) Found the 1975 monument with only the stem of the aluminum cap remaining in the pipe. The cap itself is gone but the monument does not appear to have been disturbed from its original position. The 1975 witnesses were not recovered. The monument was found to be 18.2'W and 2.2'S of the midpoint position between monumented Section corners. A further investigation showed that G3 and H3 were also reestablished by Mr. Sackett in 1975, as well as 1/16 corners #1 and #2 of Sec. 9, all in effect by single proportionate measurement E-W between E3 and I3. By referring to survey files at the MDNR Baraga office, I discovered that the 1975 calculations which produced the corner positions to be reestablished contained an error or errors which resulted in corners having been monumented thus: F3 is 6.8'W and 0.2'S; G3 is 22.7'E and 4.0'N; H3 is 13.4'E and 1.6'N; and 1/16 cor. #1 of Sec. 9 is 4.3'W and 1.0'N of the intended position. Since the monuments have been in place for very nearly 40 years and have been used to control subsequent surveys in 1978 and 2005, I decided that the most prudent course of action was to leave the existing monumented positions undisturbed. accepted the 1975 monumented positions of F3, G3, H3, and 1/16 corner #1 of Sec.9 as controlling for the subdivision of Sections 9 and 10. Monumented 1/16 cor. #2 of Sec. 9 was not coordinated in this survey.

determined to be lost, the corner was reestablished by K.L.Sackett RLS "on line between section corners east and west". Set 1"IDx36" iron pipe with 4" aluminum cap. 12" Spruce S38°E 15.8', 8"

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(F3) Found 1"ID I.pipe with stem	of broken alum. cap
affixed in the top of the pipe.	Set measuring nail
with MDNR tag in the side of:	
5" Poplar N80°E 8.9' mrkd	"1/4S NBT"
3" Spruce S04°W 10.5'	do
6" Balsam S70°W 7.15'	do
6" Balsam N40°W 7.75'	đo
Set sq'd cedar post adjacent.	
E= 7899255.115 N= 200360.108	

Spruce N34°E 10.9'. Found no subsequent record.

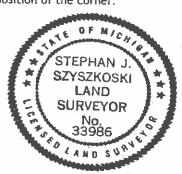

Bearings are magnetic. Coordinates are MCS83 in meters (NAD83(2011) Datum). Coord. Ref.=NGS PID RL1468: N= 199449.721 m. E= 7900600.011 m.

Signed by Stephen	Syspholic	Date	06/18/2014	
Surveyor's Michigan License No.	33986			

For the Michigan Department of Natural Resources, Forest Resources Division

Revised Jan., 1983