LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

5. Private Claims

Stephan J. Szyszkoski , in a field survey on

Baraga	Located In:	Corner Code #	
(County)	-		
1. Public Land Survey	T 49N R 34W T R	C13 (GCDB 200100)	
2. Property Controlling in Section	S T R S T R		
3. Miscellaneous Property in Sec.	S T R		
4. Lot No. , Rec	orded Plat		

Register of Deeds Stamp & File Number

02/03/16 that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey 5 instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of 6 a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with 7 the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, 8 re-established, monumented, recovered, found as expressed below: 9 10

12

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Section corner common to Sections 31-32 T49N-R34W and Sections 5-6 T48N-R34W. 1958 - Remonumented by Billy D. Buckler RLS at a position found monumented by an unknown surveyor. Found 1" iron pipe and wood post and replaced with 1" ID iron pipe with 4" brass cap. 8" J.Pine N74°W 26 links, 6" J.Pine S16°W 15 links, 6" J.Pine S78°E 14.5 links. 1987 - K.L.Sackett RLS restored the corner position "from old Billy D. Buckler survey notes and distances". Set 1"IDx72" I.pipe with plastic cap. 8" J.Pine S65°E 38.2', 7" J.Pine N35°E 22.3'. 2000 - MDNR survey staff found the 1987 monument in good condition and made new witnesses, which were not recorded.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found the 1987 monument, a 1"ID I.pipe with plastic cap, in good condition, at a position which conforms reasonably to the original record with respect to government corners along the township line and within T49N-R34W and T48N-R34W. The 1987 and 1958 witnesses were not recovered. Found the witnesses made in 2000 by MDNR survey staff in good condition with mostly overgrown blazes. The sketchy notes of the 1987 survey, found at the MDNR office in Baraga, describe a traverse that ran along the north and east lines of Section 6, T48N-R34W and make no mention of recovering the 1958 monument or witnesses. It is left to presume that "from old Billy D. Buckler notes and distances" [above] means that the 1958 corner position was reestablished from ties which appear in the 1958 notes, notably 3 trail crossings within 6 chains west of the corner; a road crossing immediately south; and a found iron pipe at the 1/4 corner between Sections 5-6 48-34. This monument has been used as the position for the Section corner in at least 5 surveys within the adjacent townships since 1987 and I accept same as the best available evidence of the position of the original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(3) Found 1"ID I.pipe with plastic cap #19006. Set measuring nail with MDNR tag in the side of: 9" J.Pine S02°W 113.25' with old blazes 8" J.Pine S67°W 107.7' do

6" J.Pine S89°W 35.35' do 7" J.Pine S81°E 21.2' mrkd "S5 NBT"

Surveyor's Michigan License No.

The above trees were originally blazed and scribed in 2000 by the MDNR. Nails/tags set this date. E= 7877740.954 N= 202369.862

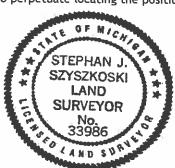

Bearings are magnetic. Coordinates are MCS83 in meters, NAD83(2011) Epoch 2010.00 datum. Coord. Ref.=NGS PID RL0476: N= 196482.409 m. E= 7879234.515 m.

	Stishen!				
gned by	_ susha	Van	source.	Date	02/24/2016

33986 For the Michigan Department of Natural Resources, Forest Resources Division