

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson
(County)

Located In:

Corner Code #

1. Public Land Survey

T 44N R 28W K11

T 44N R 28W J9

T _____ R _____

T _____ R _____

2. Property Controlling in Section

S _____ T _____ R _____

S _____ T _____ R _____

3. Miscellaneous Property in Sec.

S _____ T _____ R _____

S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

J9 Oct 25 1999

K11 Oct 18 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

| | A | B | C | D | E | F | G | H | I | J | K | L | M |
|----|----|----|----|----|----|----|---|---|---|---|---|---|---|
| 1 | | | | | | | | | | | | | |
| 2 | 6 | 5 | 4 | 3 | 2 | 1 | | | | | | | |
| 3 | | | | | | | | | | | | | |
| 4 | 7 | 8 | 9 | 10 | 11 | 12 | | | | | | | |
| 5 | | | | | | | | | | | | | |
| 6 | 18 | 17 | 16 | 15 | 14 | 13 | | | | | | | |
| 7 | | | | | | | | | | | | | |
| 8 | 19 | 20 | 21 | 22 | 23 | 24 | | | | | | | |
| 9 | | | | | | | | | | | | | |
| 10 | 30 | 29 | 28 | 27 | 26 | 25 | | | | | | | |
| 11 | | | | | | | | | | | | | |
| 12 | 31 | 32 | 33 | 34 | 35 | 36 | | | | | | | |
| 13 | | | | | | | | | | | | | |

A. Description of original monument and accessories and/or subsequent restoration:

(K11) Corner common to Sections 25-26-35-36. Reestablished in 1953 by double proportionate measurement to the original record by Dean C. DeLaMater, RLS. 1" pipe with 4" brass cap. 8" Spruce S03W 165 links, 4" W.Birch S62E 15 links.
(J9) Quarter corner common to Sections 23-26. Established in 1850 by John Burt: "39.90 set Spruce Quarter Section Post. Spruce 8 S76E 23, Spruce 8 N55W 14."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K11) Recovered the 1953 monument, a 1" dia. iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the Spruce NBT, recovered in good condition and found with blazes overgrown. The 4" W.Birch NBT was not recovered. Left the monument in place and marked 3 new witnesses as described below.
(J9) The original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 2634.45' east and west. At the position for the corner I placed a 1" I.D.x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K11) Found 1" pipe with 4" brass cap.

Blazed and scribed the following:

5" Maple N42E 16.4' "S25 NBT"

10" Sugar S46W 28.4' "S35 NBT"

5" Maple N02W 26.9' "S26 NBT"

Squared cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

(J9) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:


6" Tamarack N58E 10.4' "1/4S NBT"

5" Tamarack S31E 18.4' do

8" Tamarack S33W 16.2' do

10" Tamarack N88W 3.8' do

Squared cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

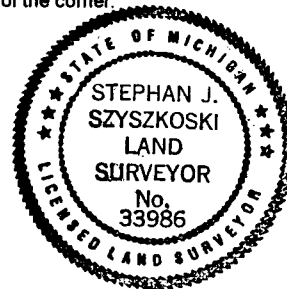

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 3/7/00

For the Michigan Department of Natural Resources - Forest Management Division