

95

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey

T 44N R 29W

14

T 44N R 29W

35

T R

T R

2. Property Controlling
In Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Jul 16 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2													
3													
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

A. Description of original monument and accessories and/or subsequent restoration:

(14) Quarter corner common to Sections 10-11. Corner established in 1848 by John Burt: "Set sugar qr. section post. N. Pine 36 S26W 16, Sugar 12 N64E 35." Found no subsequent record.

(35) Quarter corner common to Sections 11-14. Corner established in 1848 by John Burt: "Yellow Birch 10 inches in diae Quarter Section Corner." Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(14) Original post and accessories not recovered. Found no evidence of the position of the original corner on the ground.

Reestablished the corner on a straight line between monumented section corners 40.146 chains north and south. At the position for the corner, I placed a 1" I.D.x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

(35) Original corner tree not recovered. Found no acceptable evidence of the original corner position on the ground. Reestablished the corner on a straight line between monumented section corners 40.300 chains east and west. At the position for the corner, I placed a 1" I.D.x32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. The corner falls in the SE corner of a grassy plain.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(14) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following new

bearing trees:

8" Sugar S69W 39.2' 1/4S NBT"

7" Sugar N60W 27.7' 1/4S NBT"

7" Sugar N72E 37.8' 1/4S NBT"

12" Sugar S37E 48.2' 1/4S NBT"

A squared 6" double sugar scribed "1/4S" is north, 1.2'. Bearings are magnetic.

(35) Set 1" pipe with 4" MDNR cap.


Blazed and scribed the following:

10" Sugar S65E 153.9' 1/4S NBT"

4" J. Pine N74W 77.1' 1/4S NBT"

6" Poplar N20W 159.2' 1/4S NBT"

Chiseled a 12"x12" cross N54E 83.9' on the sloping west face of a granite boulder measuring 4.5' high, 9' N-S, and 5' E-W. Placed a squared sugar post adjacent. Bearings are magnetic.

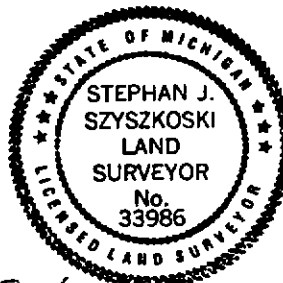

Signed by

Stephan J. Szyszkoski

Date

Sept. 3, 1996

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division