

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Houghton

(County)

Located In:

Corner Code #

1. Public Land Survey

T 52N R 35W

E7

T 52N R 35W

G7

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

G7 Jul 26 1999

E7 Jul 21 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (E7) Corner common to Sections 16-17-20-21. Corner remonumented in 1953 by Dean C. DeLaMater, RLS: 1" pipe with 4" brass cap. 14" Hard Maple N64E 77 links, 14" Hemlock N06W 56 links. Found no subsequent record.
 (G7) Corner common to Sections 15-16-21-22. Established in 1846 by S.W.Higgins. Original BT's: Cedar 14 N32W 14, Y. Birch 24 S16E 27. Corner remonumented in 1953 by Dean C. DeLaMater, RLS: 1" pipe with 4" brass cap. 10" S. Maple S60E 19 links, 12" S. Maple S05W 12 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E7) Recovered the 1953 monument as described, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1953 accessories. The hemlock is in good condition with overgrown blazes. The Sugar is rotting but has a good 8H blaze. Left the monument in place and marked three new bearing trees as described below.
 (G7) Recovered the 1953 monument, as described, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the decomposing remains of a cedar tree, found laying on the forest floor, with evidence of a 8H blaze but no scribing visible. It is presumed that the cedar is that original BT used in the 1953 remonumentation. The monument was recovered at record bearing and distance from the 1953 witnesses also. Both were recovered in good condition with overgrown blazes. Left the monument in place and marked two new accessories as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E7) Found 1" pipe with 4" brass cap.

Blazed and scribed the following:

11" Sugar N30E 22.6' "S16 NBT"

7" Sugar N58E 20.5' do

9" Basswood S47W 14.3' "S20 NBT"

Placed a squared sugar post adjacent.

Bearings are magnetic. Distances are to notch in lower blaze.

(G7) Found 1" pipe with 4" brass cap.


Blazed and scribed the following:

14" Cedar N40E 29.0' "S15 NBT"

8" Y. Birch N53W 24.4' "S16 NBT"

Placed a squared cedar post adjacent.

Bearings are magnetic. Distances are to notch in lower blaze.

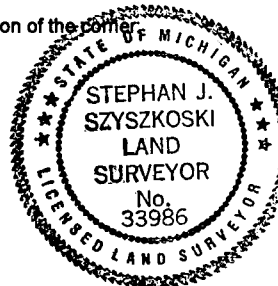

Signed by

Stephan J. Szyszkoski

Date

10/19/99

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division