ount v

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

JAN 2 5 2000

Houghton County

Located in:

Corner Code #

 Public Land Survey T55N **R33W** Т R Ŧ R T R 2. Property Controlling S T R in Section S T R Miscellaneous S T R Property in Sec. S Т R

SECTION

Mary Schoos

Register of Deeds

Houghton County, Register

Page 1 of 1

LC 4/56

PAÜ Date 12/30/1999 FEE.

Time 10:40:18

10

מולו פ

Register of Deeds Stamp & File Number


Lot No.

, Recorded Plat

5. Private Claims

i, Joseph C. Domitrovich, in a fleid survey on September 24, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

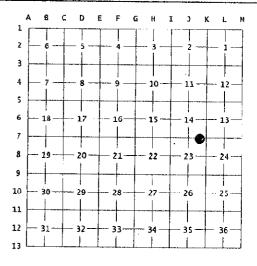

A. Description of original monument and accessories and/or subsequent restoration:

#11 (J/K-7) Meander Corner Common to Sections 14 & 23, T55N, R33W.

1846 L.S. Scranton set a post with ties:

16" Hemlock

S 58°W

11 links

5" Cedar

N 13°E

12 links

H.W. Fesing, Engineer, shows this corner as an I.P. in his field notes (Field book 38, on file with Steve Hein, P.S., Laurium). He shows the corner as being 342.30 feet East of an I.P. on the section line.

1988 John Haataja, P.S. 19833 shows a calculated position for this corner in his survey sketch of the Osceola Mill location. The position was calculated from 1937 notes, 342.97' East of a 1 1/2" iron pipe. The corner was in a washout and not found.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. I recovered a 2" O.D. iron pipe West of Meander corner position. This is the same as Fesing's I.P. and Haataja's 1 1/2" pipe. I re-established a position for the Meander corner on a line projected from the SW corner of Section 14, through the recovered 2" iron pipe at a distance of 342.97' from the 2" iron pipe. It falls 8'+/- West of the shore of Torch Lake.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" iron pipe with a brass: "Houghton County Remonumentation" cap placed on it. It falls at the toe of a steep bank. I also placed a 5/8" iron pin on Section line to the West, in centerline of old railroad grade. Ties:

8" Hard Maple N 58°E 26.97 3" Oak S 27°W 10.55 6" Hard Maple S 23°W 19.14

2" iron pipe S 89°20'03"W 342 97

(342.97' Haataja)

(342.20' Fesing)

SW Corner Section 14 5/8" iron pin with cap

S 89°20'03"W 4369.94 (4370.8' Fesing)

S 89°20'03"W 27.21' (in centerline of abandoned railroad grade)

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Surveyor's Michigan License No. 37273

10/22/29

JOSEPH DOMITROVICH

OF BIENIOR

EDISED JA

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSI