

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

Re-Mon Liber 2, Page 94

Huron  
(County)

**Corner Code #**

STATE OF MICHIGAN  
HURON COUNTY  
RECORDED

29 NOV 2000 11:22 AM

FRANCES L. HOLDWICK  
REGISTER OF DEEDS

**Register of Deeds Stamp & File Number**

1. Public Land survey: **Brookfield T 15\_N R 10\_E** A-3  
A-4 ✓
- T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_
2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_ SURVEY &  
DOCUMENTATION  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_ JAN 19 2001
4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims SECTION

I, James T. Meek, in a field survey on October 1, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:  
Original survey, West Bdy. T15NR10E, 1835,  
Harvey Parke D.S.

A-3 Corner of Sections 6, 7  
Post  
Maple 7", S46°W, 33 links  
Beech 12", N11°W, 43½ links  
County Surveyor's Record: ¾" iron  
Recorded Surveys: L4, P524; L4, P278; L3,  
P166 (All Case)  
LCRC: none

A-4 West ¼ Corner of Section 7  
Post  
B. Ash 14", S12½°W, 40 links  
Maple 18", N32°W, 19 links  
County Surveyor's Record: ¾" iron  
Recorded Surveys: L4, P278; L3, P166; L4, P19;  
L1, P493 (All Case)  
LCRC: none

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

A-3 Corner of Sections 6, 7

Found 1" pipe in man box  
At intersection of Bay Port & Canboro  
Road

Accepted as the best available evidence  
of the original corner position.

A-4 West ¼ Corner of Section 7

Found ¾" iron in mon box  
1' East of centerline of Bay Port Road  
Drain bears West

Accepted as the best available evidence  
of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


A-3 Corner of Sections 6, 7  
1" pipe in mon box  
From which:  
Road sign post bears N50°E, 41.2'  
Tag in power pole bears S50°E, 86.3'  
Concrete ROW marker bears S40°W, 46.6'  
Road sign post bears S60°W, 41.9'  
A-4, ¼ Corner of Section 7 bears  
S0°09'42"E, 2634.54'  
A-2, ¼ Corner of Section 6 bears  
N0°09'19"W, 2643.58'

A-4 West 1/4 Corner of Section 7  
1/4" iron in mon box  
From which:  
Tag in power pole bears N25°E, 106.1'  
Wood post bears S85°E, 43.7'  
1/4" iron bears S45°W, 25.0'  
Tag in power pole bears N 45°W, 45.7'  
A-5, Corner of Sections 7, 18 bears  
S0°09'20"E, 2634.63'  
A-3, Corner of Sections 6, 7 bears  
N0°09'42"W, 2634.54'

Signed by [Signature]  
Surveyor's Michigan License No. 39089

Date 2000

APPROVED AT PEER BOARD MEETING 11-02-00 RRB

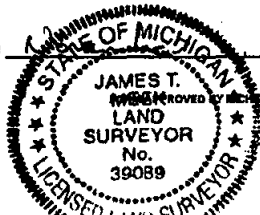

CANADIAN BOARD OF LAND SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN., 1983  
 REVISED OCT., 1985