

2000 REMONUMENTATION

Re-Monumented, Page 9.

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in

Huron
 (County)

Located in:

Corner Code #

 STATE OF MICHIGAN
 HURON COUNTY
 RECORDED

29 NOV 2000 11:22 AM

 FRANCES L. HOLDWICK
 REGISTER OF DEEDS

1. Public Land survey: Brookfield T 15_N R 10_E

T R

A-5

A-6 ✓

T R

T R

 SURVEY &
 MONUMENTATION

2. Property Controlling in Section

S T R

S T R

3. Miscellaneous Property in Sec.

S T R

S T R

JAN 19 2001

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

SECTION

5. Private Claims

I, James T. Meek, in a field survey on October 1, 2000,

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 Original survey, West Bdy. T15NR10E, 1835,
 Harvey Parke D.S.

A-5 Corner of Sections 7, 18

Post

Elm 12", N9°W, 40 links

Hemlock 14", S53½°W, 34 links

County Surveyor's Record: ¼" iron

Recorded Surveys: L4, P19; L1, P493; L4,

P184; L4, P310; L2, P311 (All Case)

LCRC: none

A-6 West ¼ Corner of Section 18

Post

Hemlock 12", S8°W, 11 links

Hemlock 17", N23°W, 40 links

County Surveyor's Record: ¼" iron

Recorded Surveys: L1, P184; L4, P310; L2, P311

L4, P311 (All case)

LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-5 Corner of Sections 7, 18

Found 1" iron in mon box

At intersection of Bay Port & Sebawaing Roads

 Accepted as the best available evidence
 of the original corner position.

A-6 West ¼ Corner of Section 18

Found ½" iron in mon box

At centerline of Bay Port Road
Occupation lines bear East & West
 Accepted as the best available evidence
 of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-5 Corner of Sections 7, 18

1" iron in mon box

From which:

Tag in power pole bears N60°E, 96.4'

Road sign post bears S20°E, 58.0'

Tag in power pole bears S40°W, 63.1'

Tag in power pole bears N45°W, 51.8'

A-6, ¼ Corner of Section 18 bears

S0°07'11"E, 2637.02'

A-4, ¼ Corner of Section 7 bears

N0°09'20"W, 2634.63'

A-6 West ¼ Corner of Section 18

½" iron w/cap #39089 in mon box

From which:

½" iron bears N45°E, 25.0'

Tag in power pole bears East, 33.6'

½" iron bears S45°W, 25.0'

½" iron bears N45°W, 25.0'

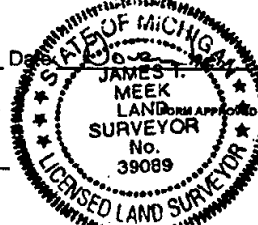
A-7, Corner of Section 18, 19 bears

S0°07'51"E, 2635.34'

A-5, Corner of Sections 7, 18 bears

N0°07'11"W, 2637.02'

Signed by

Surveyor's Michigan License No. 39089APPROVED AT PEER BOARD MEETING 11-02-00 RLLP
 MICHIGAN BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983
 REVISED OCT., 1995