
LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

| For Corners In: Kalkaska (County) | · · · · · · · · · · · · · · · · · · · | Locat | ed In | Corner Code # | BK 6 PG. 1022 | |
|--|---------------------------------------|------------|--------|---------------|---------------------------------------|--|
| 1. Public Land Survey | | T 26N | R 5W | G5 | PG. 1002 | |
| Property Controlling in Section | s | | R R | | | |
| Miscellaneous Property in Section | s s | T T | R | | Register of Deeds Stamp & File Number | |
| 4. Lot No: | Record | ed Plat: _ | | | A B C D E F G H I J K L M | |
| 5. Private Claims: | | | | | 2 6 5 4 3 2 1 | |
| I, <u>Joshua R. Davidson</u> , in a requirements of PA 74, Mic | | | | | 3 4 7 8 9 10 11 12 | |

I, <u>Joshua R. Davidson</u>, in a field survey on <u>June 24</u>, <u>2014</u> do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

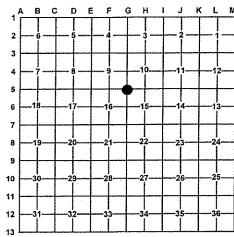

A. Description of original monument and accessories and/or subsequent restoration:

G5 - corner common to sections 9, 10, 15 & 16, T26N, R5W

- 1852 GLO Resurvey Cannon Set post. Corner of sects. 9, 10, 15 & 16. 1) SP. Pine 8" S62°W 22, 2) SP. Pine 12" N70°E 16.
- 1913 Fargo Engineering Map #3515 No U.S. evidence, set temporary stake only.
- 1978 Consumer's Power Co. Survey drawing #S-F17406 D. Ankrom, PS #21265 Found Conc. Mon. in tile ½" r.rod. 3) 3" Red Pine S62°W 3.09', 4) 6" quad red oak N50°E 64.75', 5) 3" Red Pine S45°E 10.86'.
- 1983 unrecorded survey, E. Ostling, PS #12026 Fd. Conc. Tile Mon.
- 1988 LCRC, L. 2, P. 361, G. DeLaMater, PS #13030 Found Conc. Mon. 6) 6" R. Pine S58°W 32.72',
 7) 6" R. Pine S18°E 47.90', 4) 12" Oak N41°E 66.60'.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- G5 Found 4" X 1' long tile filled with concrete with ½" rebar in center. Found witnesses #4, #6 & #7 in good condition and fitting position of tile. Accepted found tile as the best available evidence of the position of the original corner and replaced it with a 4" stamped DNR aluminum cap on 1" X 36" galvanized iron pipe. Broke tile and concrete placed around pipe.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- G5 Stamped 4" DNR aluminum cap on 1" X 36" galvanized iron pipe.

N39°E 66.60' to found nail in NW. side 15" Oak (#4) S82°E 12.33' to found nail & tag in N. side 7" twin R. Pine S20°E 47.94' to set nail & tag at found nail in E. side 10" R. Pine (#7) S67°W 32.70' to set nail & tag at found nail in NW. side 9" R. Pine (#6) N68°W 12.62' to set nail & tag at found nail in NE. side 12" R. Pine Set blue post 1' Southwest.



| Q. | an | Ad. | by: |
|-----|----|-----|-----|
| OI: | ЧH | CU | υy. |

Surveyor's Michigan License No.:

46659

Date:

DEC. 16, 2014