

JAN 15 2000

SECTION

Filed under Remonumentation Act 345 of 1990
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee
(County)

Located In:

Corner Code #

LIBER 1 PAGE 365

STATE OF MICHIGAN
LENAWEE COUNTY
FILED

15 NOV 1999 9:57:47 AM

VICTORIA J. DANIELS
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

1. Public Land Survey

T - 5-S R - 4-E

K-7

2. Property Controlling
in Section

S T R

3. Miscellaneous
Property in Sec

S T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Glenn E. Richard

, in a field survey on October 15, 1999,
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO Joseph Fletcher set post cor. Sec.'s 13, 14, 23 & 24 W. Oak 12 N 79 E 30 B. Oak 16 N 73 E 20
1849 S.C. Boughton subdivided Section 14.

1851 S.C. Boughton subdivided Section 23.

1854 S.C. Boughton subdivided SE 1/4 of Section 14. Type of monumentation not given

Could not find any information about this corner between 1854 and 1965

1965 I dug at intersection of roads and at the location where I reestablished the corner but didn't find anything.

I reestablished the corner by doubling the distance between a found strap iron at the South 1/4 corner and a found
strap iron at the SE corner of the West 1/2 of the SE 1/4 of Section 14 (as occupied) and extending the line East
I set a iron pipe. The distance between them checked the distance shown on the 1854 survey. The corner
is 8' West of North-South centerline

1972 & 1976 Kenneth Suydam found iron pipe

1975 I found iron pipe and recorded it in Liber 3, Page 195

1997 I found iron pipe in the pavement

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 15, 1999 Found 3/4" X 6" iron pipe over 3/4" X 14" iron pipe driven over 1/2" iron pipe. Replaced with
5/8" X 3" re-rod with a Lenawee County Re-mon cap stamped P.S. 13040. Set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3" re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is
accepted as the best available evidence of the position of the original corner

Fd. "X" cut in CMP N 15° E 93.16


Fd. "X" cut in CMP N 05° W 91.44

Fd. dbl. hd. nail & disc replaced with dbl. hd. nail and Lenawee County Re-mon tag in

E. pole S 60° W 58.10

Bolt at SW corner of optic fibe (fiberglass) vault N 55° E 46.95

The corner is in the E. and W. centerline and is 8' west of the N. and S. centerline

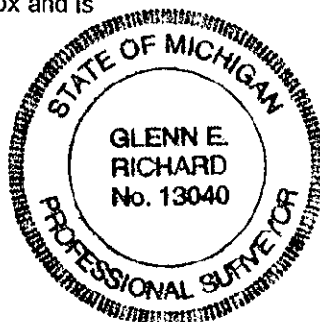

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date October 26, 1999

Signed by Glenn E. Richard Date Oct. 29, 1999
Glenn E. Richard

Surveyor's Michigan License No. 13040

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 26, 1971

REVISED MAY 14, 1975

REVISED JAN., 1993

ADAPTED FOR WORD PROCESSING MARCH, 1993