

JAN 22 2001

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee

(County)


Located in:

Corner Code #



LIBER 1

PAGE 428

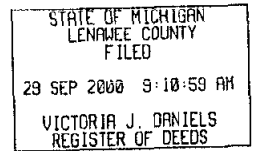

Register of Deeds Stamp & File Number

1. Public Land Survey T 5 - S R 4 - E K-4
T _____ R _____
T _____ R _____
T _____ R _____
2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
Property in Sec S _____ T _____ R _____

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard in a field survey on September 22, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1819 Joseph Fletcher D.S. set 1/4 Sec. post W. Ash 10 S 33 W 8 W. Oak 20 N 14 W 11
1835 Sattethwaite records of the subdivision of Section 11 and 12
1967 I couldn't find any information on this corner after 1835. I dug but didn't find any trace of the corner. I set a 1/2" iron pipe in line with fence lines East and West by proportional distance of the 1835 surveys from the occupied center of Section 11 and the computed center of Section 12. I also set a 1/2" iron pipe 33' East on the 1/4 line
1974 I found iron pipe
1975 Werner Sommer found iron pipe
1976 I found iron pipe prior to paving by the Lenawee County Road Commission and recorded it in Liber 3, Page 395
1990 & 1994 I found iron pipe in monument box

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

September 14, 2000 Found monument box under new patch in asphalt pavement
September 22, 2000 Found 1" iron pipe in monument box with two adjusting rings to bring up to surface of new asphalt pavement. I also found the 1/2" iron pipe that I had set on the 1/4 line east 33'. Set 5/8" X 3' re-rod in top of the 1" iron pipe and drove them both down and capped with Lenawee County Re-mon cap stamped P.S. 13040

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 and is accepted as the best available evidence of the position of the original corner.

Dbl hd nail & re-mon tag in W. face of 26" Walnut S 20° W 93.34
Fd. iron pipe on 1/4 line West 33.04
Fd. iron pipe on 1/4 line East 33.03
Cut "X" on West end CMP N 45° W 15.52
Fd. dbl hd nail & disc in E.P. East 32.48
Fd. P.K. nail in E.P. S 50° E 35.23



Ratified by Peer Group in accordance with P.A. 345 Co. Re. Glenn E. Richard Date September 26, 2000

Signed by Glenn E. Richard Date Sept. 28, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040