

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION



LIBER 1


PAGE 426

For corners in

Lenawee
(County)

Located In:

Corner Code #

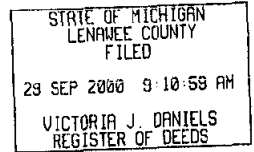

1. Public Land Survey T 6 - S R - 3 - E A-2
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec S T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Glenn E. Richard in a field survey on August 22, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. This position not established by original government surveyors
Could not find any information on this corner prior to 1941
1941 Walter Frazier "Did not find 1/4 but set IP (1/2 fences) Drove iron and placed stone-Temp W 1/4 post Sec. 6" which checked deed distance to fence line to the east, South 685.1'
1963 Werner Sommer, found iron pipe
2000 I found 5/8" re-rod with top bent 0.93 East of line between M-2 & M-3 T6S R2E

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

August 22, 2000 Kevin Pickford dug and had to remove a large stone 18" deep to set a 30" Harrison Monument 0.93 West of found 5/8" re-rod on bearing of East and West 1/4 line.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

30" Harrison Monument 6" deep stamped P.S. 13040. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.

Re-rod on East and West 1/4 line East 33.03
Cut "X" on East end C.M.P. S 50° E 20.34
SW corner of House #6517 foundation N 50° E 153.71
dbl hd nail & re-mon tag in W. face of E.P. N 20° E 206.21

M-2 T6S R2E North 464.65
Centerline of gravel road 5'± West



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 8, 2000

Signed by Glenn E. Richard Date Sept. 25, 2000

Glenn E. Richard

Surveyor's Michigan License No. 13040