

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee

(County)

Located In:


Corner Code #



LIBER 2

PAGE 15

1. Public Land Survey T-7-S R-1-E M-5  
T R  
T R  
T R
2. Property Controlling S T R  
in Section S T R
3. Miscellaneous S T R  
Property in S S T R

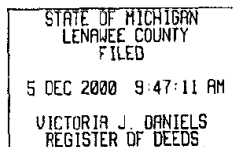

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

I, Glenn E. Richard, in a field survey on October 2, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1824 John Mullett D.S. set post corner Sec.'s 12 & 13 B. Ash 6 S 38 W 7 Maple 7 N 42 W 45  
1870 Burton Kent "Found as established years ago"  
1887 James Blair found iron bar under a large stone  
Early 1900's John L. Richard's red book record is same as Blair's plus "Found about 7' North of North road fence going west  
1925 Walter Frazier survey for MSHD "SE corner Section 12 T7S R1E iron spike in center of stone road. Gas pipe at A-5 T7S R2E South 29"  
1927 John L. Richard surveyed Morey Hwy. and labels this as SW corner Sec. 7. Type of monumentation not given.  
1972 I found RR spike under the pavement, raised with P.K. nail and recorded it in Liber 1, Page 323. Iron pipe in pavement South 29.04= SW corner Sec. 7 T7S R2E

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 2, 2000 Found RR spike 6" deep over stone 17" deep. Highest spot on stone was 0.2 E. Broke up stone to remove it & found 1/4" X 2 1/2" X ? strap iron 0.5 East. Set 5/8" X 3" re-rod, Lenawee County Re-mon cap at location of Fd. RR spike. Placed pieces of the stone around the re-rod and set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3" re-rod with Lenawee County Remon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

NE corner of concrete Hdwl S 67° W 39.52  
NW corner of concrete Hdwl S 67° E 40.64  
SE corner of concrete Hdwl S 36° W 60.84  
Fd nail & disc in E.P. S 10° W 96.62  
Dbl hd nail & re-mon tag in T.P. N 87° W 22.26

A-5 T7S R2E South 29.01



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date November 28, 2000

Signed by Glenn E. Richard Date Nov. 29, 2000  
Glenn E. Richard

Surveyor's Michigan License No. 13040