

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

SECTION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)


Located In:

Corner Code #



LIBER 2

PAGE 17

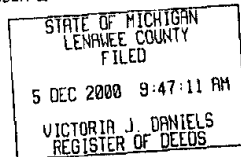

1. Public Land Survey T-7-S R-1-E M-7
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec S T R

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

I, Glenn E. Richard, in a field survey on October 12, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1824 John Mullett D.S. Set post cor. Sec.'s 13 & 24 B. Ash 9 S 34 W 64 B. Ash 18 N 34 W 30
1880's James Blair record stone and bricks 1 foot under ground
Early 1900's John L. Richard's record is the same as James Blair record
1950 Walter Frazier did survey in Section 18 T7S R2E "Had dip. Set RR spike 21.1 South
1961 While employed by Walter Frazier I dug and found iron pipe & raised to the surface with boat spike
1974 I found boat spike and recorded it in Liber 2, Page 683
1975 Max Walter MDOT surveyor found boat spike 21.12 N. of M-34 centerline as per witnesses. Replaced with survey marker, installed in monument box. N 30° E 57.47 P. pole S 15° W 82.20 traf. signal pole
1976 I found 1/2" re-rod with brass cap in monument box SW corner of gas station N 50° E 57.1

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 21, 2000 I found piece of 9/16 brass coated rod with brass cap in monument box. Removed the rod and found it was wedged in the top of a 3/4" galv. pipe with pinch bottom. I cut the brass cap off and replaced the 3/4" X 24" galv. pipe & 9/16" X 24" rod and placed a Lenawee County Re-mon cap on top.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

9/16 X 24" brass coated rod in top of 3/4" X 24" galv. pipe with Lenawee County Remon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

Fd. nail & disc in E.P. N 65° W 33.18
Set dbl hd nail & re-mon tag in traffic light pole S 15° W 82.85
Set dbl hd nail & re-mon tag in E.P. N 30° E 57.46
Corner of old gas station N 50° E 57.25
"X" cut in W. face of "T" rail post N 75° E 110.63
Fd. nail & disc in NW face of E.P. S 20° E 101.34



Ratified by Peer Group in accordance with P.A. 345 Co. Reg. Glenn E. Richard Date November 28, 2000

Signed by Glenn E. Richard Date Nov. 29, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040