

JAN 22 2001

SECTION

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Lenawee

(County)

Located In:

Corner Code #



LIBER 2

PAGE 6

1. Public Land Survey

T 7-S R 5-E

M-9

T R

T R

T R

2. Property Controlling
in Section


S T R

S T R

3. Miscellaneous
Property in Sec

S T R

S T R

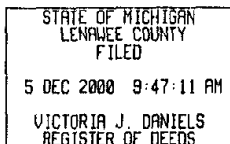

Register of Deeds Stamp & File Number

4. Lot No.

Recorded Plat

5. Private Claims

I, Glenn E. Richard

, in a field survey on October 16, 2000

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO 1819 Joseph Fletcher D.S. Set post cor. Sec.'s 24 & 25 Popple 12 N 28 W 23 Maple 9 N 85 W 17

1883 James Blair found corner, set stone with "X" on top Butternut N 53 1/4 W 78 (51.48")

1919 John L. Richard found stone & bricks Butternut N 54 1/4 W 51.0

1956 Werner Sommer (employed by Walter Frazier) found IP deep. Set IP on top

1973 I found 5/8" iron pipe

1978 I found 1/2" iron pipe and recorded it in Liber 4, Page 190. SE corner of garage S 30° W 1112.86

1981 The road was surveyed by the Lenawee County Road Commission engineer and I believe they rebuilt the road and set monument boxes.

1984 I found iron pipe in monument box

1987 & 1993 Kenneth Suydam used the corner. E.P. N 70° W 42.79

1996 Michael Bartolo found 1/2" iron pipe in monument box. N 40° W 65.18 Fd. nail & shiner SW face of 40" cottonwood N 70° W 42.91 Fd nail & shiner E. face E.P. S 65° W 94.41 NE corner attached garage

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

October 16, 2000 Found 1/2" X 12" iron pipe in top of 1 1/2" X 18" galv. pipe in monument box. Replaced the 1/2 iron pipe with 5/8" X 3' re-rod with Lenawee County Re-mon cap. The box is 1.5' west of the pavement centerline. I found the boat spike that Werner Sommer set in 1956 on the section line to west which checked the line. Record 147.58' meas. 147.50' . I probed but didn't hit any stone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod in side of 1 1/2" X 18" galv. pipe with Lenawee County Re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

Fd. nail & disc in NE face of E.P. N 65° W 42.85

Fd. nail & disc in SW face of 40" Cottonwood 73.54

SE corner of Church Foundation N 50° W 123.98

NW corner of Hse foundation S 65° W 117.80

NE corner of garage foundation S 35° W 94.53

SE corner of garage foundation S 30° W 112.75

RR spike at A-9 T7S R6E North 85.15

The corner is 1.5 west of pavement centerline

Ratified by Peer Group in accordance with P.A. 345

Co. Rep. Glenn E. Richard

Date September 26, 2000

Signed by Glenn E. Richard

Glenn E. Richard

Date Nov. 7, 2000

Surveyor's Michigan License No. 13040

