

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Luce Co.

5 Corners

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>47</u> N. R. <u>10</u> E.	K-11, L-12, L-11
2. PROPERTY CONTROLLING IN SECTION <u>36</u>	T. <u>47</u> N. R. <u>10</u> E.	8-Sec. 36, 1-Sec. 36
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E.	
4. LOT NO. , RECORDED PLAT		
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 4-27, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on 19, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:
- K-11 Sec. Cor., 25-26-35-36, set by Geo H. Cannon, D.S. in 1853. Bearings were: Sugar 20", S110°E, 22 lks. & Y. Birch 24", N87°W, 63 lks.
  - L-12 Center Corner, Section 36.
  - 8-Sec.36 West 1/16 Corner, Section 36.
  - L-11 1/4 Corner bet. Sec's. 25-36, set by Geo. H. Cannon, on a Correctional Survey of Township in 1853. Bearings were: Cedar 10", N63°E, 16 lks. & Cedar 12", S71°E, 20 lks.
  - 1-Sec.36 West 1/16 Corner bet. Sections 25-36.


- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- K-11 Found a 1/2" Iron Pipe at corner. Found another Iron, 7.6' South and 2.3' East of corner. Corner lies in an old road intersection, records before 1900 confirm this.
  - L-12 Placed center corner at intersection of lines intersecting opposite 1/4 corners.
  - 8-Sec.36 Placed corner midway bet. 1/4 cor. to West and center corner to East.
  - L-11 Re-established cor. midway and on line bet. two Sec. Cors. Found numerous Cedar remains in vicinity but could identify none as original bearings. Found several old blazes to East of the corner, along line.
  - 1-Sec.36 Placed corner midway bet. Sec. Cor. to West and 1/4 Cor. to East.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- K-11 Placed 36" T-Iron at corner. No witnesses available.

Placed 1" pipe with 4" alum. cap at remaining corners. Bearings are:

- L-12 6" Cedar, N180°E, 8.6' & 5" Cedar, S3°E, 19.9' & 5" Cedar, S83°E, 13.9'.
- 8-Sec.36 6" Cedar, N26°E, 42.7' & 6" Cedar, N45°E, 40.1'.
- L-11 14" Cedar, S80°E, 24.9' & 7" Cedar, N54°W, 13.7' & 7" Cedar, S71°W, 10.0'.
- 1-Sec.36 5" Jack Pine, N68°E, 61.6'.

SIGNED BY Billy D. Buckler DATE 5-5-81  
 Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

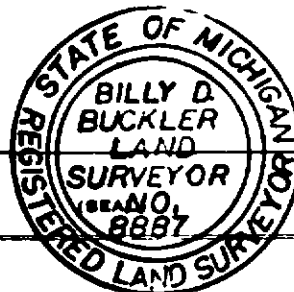

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
 CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
 MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_