

MICHIGAN
DEPARTMENT OF CONSERVATION
FORESTRY DIVISION

LAND CORNER RECORD

T. 42N N.R. 1W


Mackinac COUNTY

DESCRIPTION OF CORNER Sec. Cor. common to Sections 13-14-23-24

CORNER MONUMENT 1" pipe with 4" aluminum cap

DATE MONUMENT PLACED AND WITNESSED 7/27/70

WITNESSES TO CORNER..... 12" Hard Maple (NBT) S.10°E 78.6'

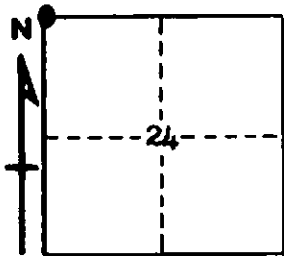

12" W. Spruce (NBT) N.46°W 29.4'

14" W. Birch (NBT) N.5°E 49.2'

AND

CIRCLE CORNER REGISTERED

DESCRIPTION IN DETAIL AS TO HOW CORNER WAS LOCATED AND IDENTIFIED OR RESTORED.

Placed this section corner, 85.0' north of a 3/4" iron pipe, set by R. Larson, R.L.S. about 1965. I have discussed this corner location with Mr. Larson and with Mr. Bennett, owner of W $\frac{1}{2}$ SW $\frac{1}{4}$, Sec. 13, T42N R1W and after extensive survey work, cannot accept Mr. Larson's corner as being in the original location.

In placing this corner, I have accepted the old fence lines running to the north and south; an old clearing edge, running to the west; an unimproved road to the east, as evidence of the corner location. Some of these fences are more than 50 years old. An old clearing and former buildings, indicate the NE $\frac{1}{4}$ NE $\frac{1}{4}$, Sec. 23 to have been occupied about 60-70 years ago.

I find a stream crossing 2,270' west to check with record distance.

Found a fence corner, 2,680' north of this section corner. This half mile is a continuous fence line about 50 years old.

We do find discrepancies:

The distance south from this corner to Sec. Cor. 23 24 is 5,686.0' or 406.0' longer than record.

We have found several miles in this township to be much longer than record. I believe this is because of poor sub-division work done by James H. Mullett, Deputy Surveyor in 1845.

SURVEYOR'S SEAL

SIGNED Billy D. Buckler DATE 7-29-70
REGISTERED LAND SURVEYOR