

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located in:

Corner Code #

1. Public Land Survey

T 42N R 11W

E10

T 42N R 11W

G10

T R

T R

2. Property Controlling
in Section

S

T R

S

T R

3. Miscellaneous
Property in Sec.

S

T R

S

T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Nov 23 2004

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(E10) Quarter corner common to Sections 28-29. 1850 - Established by Wm. Ives, Deputy Surveyor: S26°W corrected between Sections 28 and 29 ...40.33 Set quarter section post. Yellow Birch 18 N73W 14 links, Yellow Birch 18 S78E 17 links. ... 80.66 Section corner. Found no subsequent record.

(G10) Quarter corner common to Sections 27-28. 1850 - Established by Wm. Ives, Deputy Surveyor: N33°E corrected between Sections 27 & 28 ...40.70 Fir 9 for quarter section corner. Cedar 20 S70E 24 links. ...81.40 Section corner. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E10) The original post and accessories have been destroyed by road construction. Reestablished the corner midway and on a straight line between Section corners 2667.95' north and south (2661.8' G10 record). From the position thus established, the center of S. Gould City road is 5 feet west.

(G10) The original post and accessories were not recovered. Reestablished the corner at the proportionate position, midway and on line between Section corners 2676.55' north and south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E10) Set 5/8"x24" rebar with plastic cap "MICH DNR PS33986" driven flush with the asphalt surface. Set measuring nails in:

Power pole EN4 177 94X, S54E 37.55'

Power pole EN4 177 94, S68W 46.95'

8" Beech N77E 35.55' mrd "1/4S NBT"

6" Beech S35E 49.35' do

Bearings are magnetic. Distances are to nail with tag.

(G10) Set 1"IDx36" I.pipe with 4" alum.

MDNR cap. Set measuring nails in:


3" Balsam S80W 11.9' no markings

3" Balsam N60W 20.6' no markings

3" Balsam N80E 10.15' no markings

4" Balsam S80E 49.8' mrd "1/4S NBT"

Bearings are magnetic. Distances are to nail with tag. Cor. falls in clearcut with regenerating Aspen and Balsam.

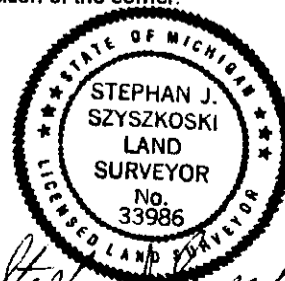

Stephan J. Szyszkoski

Signed by

Date

12/7/04

Surveyor's Michigan License No.

33986