

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970  
Mackinac Co. 3 Corners.

FOR CORNERS OF:-	LOCATED IN:-	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY-----	T. <u>43</u> N. <u>X</u> , R. <u>6</u> W. <u>X</u>	L-7, K-4, K-6
2. PROPERTY CONTROLLING IN SECTION-----	T.-----, N.-----, S.-----, R.-----, E.-----, W.-----	
3. MISCELLANEOUS PROPERTY IN SECTION-----	T.-----, N.-----, S.-----, R.-----, E.-----, W.-----	
4. LOT NO.-----, RECORDED PLAT-----		
5. PRIVATE CLAIMS-----		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 9/13, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
All corners set by H. Brevoort, Jr. D.S. in 1845.

L-7 $\frac{1}{4}$ Cor. Bet. Sec's. 13-24.	K-4 $\frac{1}{4}$ Cor. Bet. Sec's. 11-12.	K-6 $\frac{1}{4}$ Cor. Bet. Sec's 13-24.
Bearings were:	Bearings were:	Bearings were:
Cedar 8", S72°W, 16 lks.	Cedar 8", N25°E, 05 lks.	A Maple 14" for corner.
Cedar 6", N11°E, 11 lks.	Cedar 8", S64°E, 13 lks.	No witnesses.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

L-7 Re-established corner midway and on line bet. two Sec. Cors. Corner lies in a Pine plantation. Marcus Schaaf, R.L.S. records he found this corner in 1937. Apparently the tree planting obliterated the marker. Found no evidence of any corner.

K-4 Re-established corner midway bet. Sec. Cors. Found this position to be on a hill 12' above the river bottom. Record notes indicate this to be swamp. The corner would have to be at least 50' East of a strait line to be in the swamp. Placed corner on a strait line as intended.

K-6 Re-established corner midway and on line bet. two Sec. Cors. No evidence of original corner. Corner lies in a R. Pine plantation.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
Placed 1" pipe with 4" aluminium cap at all corners.

L-7 New Bearings:	K-4 New Bearings:	K-6 New Bearings:
6" R. Pine, S69°W, 46.5'	8" R. Pine, S51°W, 56.8'	8" R. Pine, S74°W, 18.0'
8" R. Pine, S65°E, 11.4'	10" R. Pine, N64°W, 60.3'	12" R. Pine, N24°E, 5.2'
10" R. Pine, N45°W, 56.0'	12" R. Pine, North, 60.7'	12" R. Pine, S44°E, 22.7'

SIGNED BY Billy D. Buckler

DATE 9/19/77

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

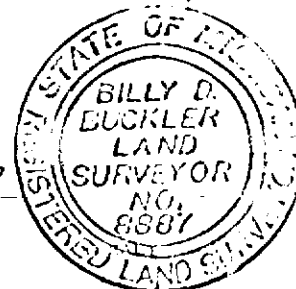

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_