REMON. COR. J-9, LARKIN TWP. LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

519

12

13

24

25

36

23 22

26 27

35 34

| | (ming | | |
|--|---|---|---|
| For comers in Midland (County) | Located in: | Corner Code # | STATE OF MICHIGAN MIDLAND COUNTY REMONUMENTATION & FILED |
| 1. Public Land Survey | T 15N R 2E TR | J-9 | 12/28/2000 8:44:27 AM |
| Property Controlling in Section Miscellaneous | T_R T_R ST_RRE ST_R ST_R | SURVEY & MONIUMENTATION FEB 2 3 2001 | SCOTT I. HAINES REGISTER OF DEEDS Register of Deeds Stamp & File Number |
| Property in Sec. 4. Lot No, Recorded P. 5. Private Claims, In a field survitat under requirements of P.A. 74, Miclines 1 and 2 above were in conformar in the current manual of survey instruction, Bureau of Land Management corner points mentioned in lines 3, 4 of the Michigan Board of Land Survey. | ey on May 25, 2000, do hishigan P.A. of 1970, the cornce with regulations and ruluctions of the United State or by a decree of a Count and 5 above were in configurations as proceed of a Count and 5 above were in configurations. | es therefore as requires es Department of the of Law and/or that the ormance with the rules urt of Law; re-established, | A B C D E F G H J J K 2 - 6 - 5 - 4 - 3 - 2 - 3 4 - 7 - 8 - 9 - 10 - 11 - 5 6 - 18 - 17 - 16 - 15 - 14 - 7 |

A. Description of original monument and accessories and/or subsequent restoration:


NOTE: Not more than 2 corners, all in the same town and range, may be

1/4 Corner common to Sections 23 and 26 J-9

recorded on this certificate.

monumented, re-monumented, recovered, found as expressed below:

Survey by Glo, 1830, set post Survey by F. Gibbs, 1907, 1918, gas pipe Survey by Dow Chemical Co., 1951, pipe Survey by M. Hunter, 1963, found Survey by M. Hailler, 1968, found
Survey by D. Whittier, 1968, found
Survey by D. Ankrom, 1976, found ½" pipe
Survey by J. Schafer, 1976, 1983, found ½" pipe in monument box
Survey by J. Jones, 1995, 1997, found bolt in monument box LCRC by P. Lapham, 1983, monument box

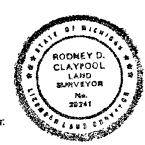

19

30

31 12

9

10 11 20

29

32

28

33

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

1/4 Corner common to Sections 23 and 26 J-9

Found 1/2" pipe under bolt in monument box per surveys by F. Gibbs, M. Hunter, D. Whittier, D. Ankrom, J. Schafer, J. Jones and LCRC by P. Lapham.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner.
- 1/2 Corner common to Sections 23 and 26

Replaced bolt with 5/8" rod and brass cap stamped Midland Co. Remon Cor PS 29241, and is accepted as the best available evidence of the position of the accepted corner.

S 50 Deg E, 67.51, nail and plastic disc in power pole, Rec. 67.80, 67.46

S 70 Deg E, 92.36, centerline top fire hydrant N 10 Deg W, 50.36, pk nall in corner fence post, Rec. 50.11

N 45 Deg W, 57.58, centerline top telephone box, Rec. 57.62

N 25 Deg E, 50.40, nail and plastic disc in 12" Spruce

| Date 12-/2-00 Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971 Revised May 14, 1971 Revised Jan., 1983 |
|---|
| = |

APPROVED LAND CORNER P.A. 345 OF 1990 MIDLAND COUNTY

10/22/00 919