

REMON. COR. K-9, LARKIN TWP.  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

520

For corners in  
Midland

(County)

Located in: Corner Code #

1. Public Land Survey

T 15N R 2E K-9

T R

T R

T R

2. Property Controlling  
in Section

S T REMONUMENTATION

S T R

3. Miscellaneous  
Property in Sec.

S T R FEB 23 2001

S T R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_ SECTION \_\_\_\_\_

5. Private Claims \_\_\_\_\_

STATE OF MICHIGAN  
MIDLAND COUNTY  
REMONUMENTATION & FILED

12/28/2000 8:44:27 AM

SCOTT I. HAINES  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, RODNEY CLAYPOOL, in a field survey on May 25, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned on lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-9 Corner common to Sections 23, 24, 25 and 26

Survey by Glo, 1830, set post

Survey by F. Gibbs, 1907, 1918, cast iron

Survey by Dow Chemical Co., 1951, found  $\frac{3}{4}$ " bolt

Survey by M. Hunter, 1954, 1960, 1963, found

Survey by D. Whittier, 1970, found

Survey by D. Ankrom, 1976, found  $\frac{1}{2}$ " iron

Survey by J. Schafer, 1977, 1979, 1983, found 1" x  $\frac{1}{4}$ " bar in monument box

Survey by J. Jones, 1979, 1982, 1985, 1988, 1995, 1998, 1999, found bolt in monument box

LCRC by P. Lapham, 1983, monument box

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-9 Corner common to Sections 23, 24, 25 and 26

Found bolt in monument box per surveys by F. Gibbs, Dow Chemical Co., M. Hunter, D. Whittier, D. Ankrom, J. Schafer, J. Jones and LCRC by P. Lapham.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-9 Corner common to Sections 23, 24, 25 and 26

Replaced bolt with 5/8" rod and brass cap stamped Midland Co. Remon Cor PS 29241, and is accepted as the best available evidence of the position of the original corner.

S 45 Deg E, 46.65, Northeasterly corner concrete post. Rec. 46.75


N 60 Deg E, 80.98, nail in 15" Pine. Rec. 80.95

N 40 Deg E, 46.14, nail in guy pole (L.P.) Rec. 46.13

N 20 Deg W, 113.10, pk nail in power pole. Rec. 113.10

S 45 Deg W, 62.84, pk nail in power pole. Rec. 62.77

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

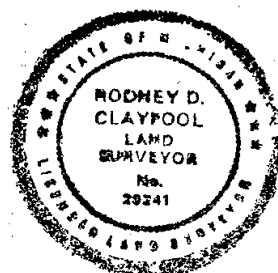

Signed by Rodney D. Claypool  
Surveyor's Michigan License No. 29241

Date 12-12-00

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971  
Revised May 14, 1971  
Revised Jan., 1983

APPROVED LAND CORNER  
P.A. 345 OF 1990  
MIDLAND COUNTY

12/27/00 JRG