

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
MONTCALM

(County)

Located In:

Corner Code **6-11**

1. Public Land Survey

T 9N R 8W

6-11

T _____ R _____

T _____ R _____

T _____ R _____

2. Property Controlling
in Section

S _____ T _____ R _____

S _____ T _____ R _____

3. Miscellaneous
Property in Sec.

S _____ T _____ R _____

S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, GARY C. BILOW, in a field survey on AUGUST 3, 19 90, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

W. OAK 6" MARKED AS CORNER BY U.S. GOVERNMENT DEPUTY SURVEYOR NOAH BROOKFIELD, 1837. CORNER TREE RECOVERED IN MAY, 1892 BY MONTCALM COUNTY SURVEYOR E.H. JONES WHO SET NBT: W. OAK 14 567W 63 LINKS. STUMP OF CORNER TREE AND JONES' NBT RECOVERED BY MONTCALM COUNTY SURVEYOR J.F. DAoust, DEC. 1923, WHO DROVE IRON PIN AND 16" LONG PIECE OF RAILROAD IRON IN DECAYED CORNER TREE STUMP BOTTOM. DAoust'S NBT: OAK STUB (FENCE CORNER) WITH BLAZE AND TWO NOTCHES, N14-1/4W 30.8'. DAoust ALSO SHOWS DISTANCES EAST TO W1/8 CORNER BETWEEN SECTION 34 AND SECTION 27 (1336'), AND THENCE TO THE NORTH 1/4 CORNER OF SECTION 34 (1336'). CORNER RECORDED UNDER ACT 74, P.A. 1970 BY PAUL E. VAN KOOTEN, LS 88618, JAN. 1981, AS "FOUND 1-1/2" IRON 5' EAST OF OLD FENCE TO SOUTH; 8' EAST OF OLD FENCE TO NORTH". SEE LCRC REC. LIBER 1, PAGE 541 FOR ACCESSORIES.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND NO EVIDENCE OF ORIGINAL CORNER TREE, SUBSEQUENT ACCESSORIES, OR DAoust'S IRONS. CORNER LOCATION HAS APPARENTLY BEEN DISTURBED BY CLEARING AND CONSTRUCTION OF POWER LINES. FOUND AND ACCEPTED A 1-1/2" IRON PIPE ON A SMALL KNOLL AT THE NORTH EDGE OF THE CLEARING FOR THE POWER LINES. VAN KOOTEN'S ACCESSORIES CHECK FAIRLY WELL ALTHOUGH POWER POLE NOTED IN SOUTHEAST QUADRANT IS GONE. FOUND PIPE DOES NOT APPEAR TO BE DISTURBED AND WAS FOUND MARKED BY A FLAGGED WOODEN STAKE. DISTANCE FROM CORNER TO A FOUND RE-ROD AT THE WEST 1/8 CORNER BETWEEN SECTION 34 AND 27 MEASURES 1' SHORTER THAN DAoust'S RECORD. DISTANCE EAST FROM CORNER TO FOUND 1-1/2" IRON PIPE AT H-11 MEASURES 2' SHORTER THAN DAoust.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

FOUND 1-1/2" PIPE

N51W 75.97' (ON SLOPE) SET SPIKE AND MICHIGAN DEPARTMENT OF NATURAL RESOURCES TAG IN 15" OAK
S53W 80.20' (ON SLOPE) SET SPIKE AND MDNR TAG IN 16" OAK
S20W 141.73' (ON SLOPE) SET SPIKE AND MDNR TAG IN POWER POLE
EAST 99.97' FOUND 1/2" RE-ROD WITH PLASTIC CAP #5132

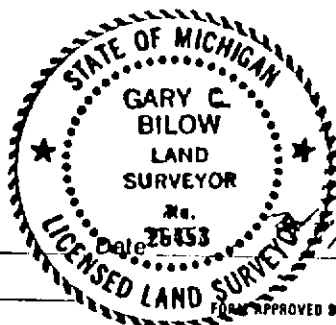

Signed by Gary C. Bielow
Surveyor's Michigan License No. 26453

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983