RECORDING FEE:

LAND CORNER RECORDATION CERTIFICATE (Intension County

Filing Requirement of Act 74, Mich. P.A. 1970 of 1

LC 5/322 Time 12:13:41 9.00

For corners in

**Ontonagon County** Located in: Comer Code # T52N R39W M - 13 1. Public Land Survey **T52N R38W** A - 13 T51N R39W T51N R38W 2. Property Controlling R in Section S T R R Miscellaneous S T S R Property in Sec.

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number


4. Lot No.

, Recorded Plat

5. Private Claims

I. Joseph C. Domitrovich, in a field survey on June 14, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

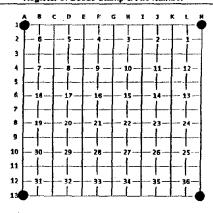

A. Description of original monument and accessories and/or subsequent restoration:

(M - 13) Township Corner, Section 36, T52N R39W, Section 31, T52N R38W, Section 1, T51N R38W, and Section 6, T51N R39W.

1845 ~ William A. Burt intersected Range line 46 links South of temporary post and set post, corner of Township 52 & 51 North & Range 38 & 39 West,

14" Maple

N 27°E

25 links

12' Sugar

S 57°W

20 links 21 links

- 1956 Ned Hawley, Timber cruiser, noted in his copy of the original notes and in a note on loose paper in the field book that he found a cedar stake at the corner. He noted that the cedar stake fell at the top of hill to river, north of slight draw. He made a note to verify that both B.T.'s were maple but does not indicate if he did find , original B.T.s.
- B. Description of comer evidence found and/or method applied in restoring or reestablishing comer:

I found no remains of the original corner. I found the rotten remains of the cedar post (stake) called for by Hawley. A shallow depression with remains of unidentified rotten wood corresponds with where the 14' Maple B.T. would fall. The post falls at the west top of ravine, 8' +/- north of a shallow feeder ravine as called for by Hawley. Distances to section corners East, West and North work well with GLO. I have accepted the position of the cedar post as the township corner.

Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

OF MICH

JOSEPH DOMITROVICH

LAND BURVEYOR

Corner is a 2 %" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, T51N, R39W, R38W; S. 36, S. 31, S. 6, S. 1; 2000; P.S. 37273. Corner falls on Northerly edge of power line clearing. Ties:

7° Soft Maple M<sub>0</sub>08 M 42,51' Sign Rail North 1.00' (to face) 6" Hard Maple N 33°F 38.67 6" Yellow Birch S 79°E 22.58 Southerly Power Pole #261 S 63°W 112.52 SW Cor. Sec. 36 S 89°52'50"W 5314.26' (5280 GLO) 5366.15' (5360.52 GLO) SE Cor. Sec. 31 S 89°55'42"E 5268.61' (5280 GLO) NE Cor. Sec. 36 N 00°18'27"W

Signed by Ah C. Dun h

Date 4/21/03

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 25, 1971 REVISED MAY 14, 1975 REVISED JAN., 1993 REVISED COT., 1893