9.00

LAND CORNER RECORDATION CERTIFICATE of 1 Ontonagon County Filing Requirement of Act 74, Mich. P.A. 1970 to 09/06/2000

RECORDING FEE:

LC 5/336 Time 09:50:16

For corners in

Ontonagon County Located in: Corner Code # 1. Public Land Survey T51N R38W T51N R39W T R T R Ť 2. Property Controlling R S in Section S Ţ R Miscellaneous S R T

s

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION


Register of Deeds Stamp & File Number

Property in Sec. 4. Lot No. . Recorded Plat

5. Private Claims

1, Joseph C. Domitrovich, in a field survey on August 4, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

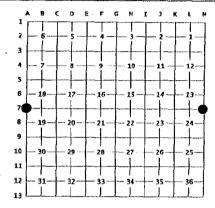

A. Description of original monument and accessories and/or subsequent restoration:

(A - 7/M - 7) Corner Common to Sections 18 & 19, T51N, R38W and 13 & 24, T51N, R39W.

1846 – Austin Burt set a Fir post (the corner falls 1.00 chains south of a 35 links stream to the NE) with ties:

16" Elm 18" Elm S 77°E

15 links

S 76°W

46 links

1846 - S.W. Higgins added a B.T.:

12" Elm

N 20°E

36 links

1966 - C.C. Lindgren, R.L.S. #14098, for Michigan State Highway Department found a 1" iron pipe at a Fence Corner. They added three N.B.T.s:

> 4" Maple N 45°W 15.70 4" Maple S 65°E 8 48 4" Maple S 55°W 23.80"

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I recovered the 1" iron pipe and three bearing trees called for by Lindgren. The 4" Maple at N 45°W and the 4" Maple at S 65°E are now dead but standing. This pipe falls at record bearing and distance form the original 16" Elm B.T., now a 22"+ rotten stump with a grown over toe blaze. I found no remains of the original 18" Elm B.T. The pipe works well with the stream call to the Flintsteel River to North. I accepted the 1" iron pipe as the true corner and replaced it with a County Monument. I added a sign rail and three new bearing trees.

Research on file with County Remonumentation Representative.

COUNTY

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: 8-23-60

The Corner is a 2 ½" x 30" aluminum pipe with a 3" aluminum cap stamped to read: COUNTY REMONUMENTATION; T51N, R39W, R38W; S. 13, S. 24, S. 18, S. 19; 2000; P.S. 37273. The corner falls 50' +/- South of the Flintsteel River, and on the extension of an old fence to the West. Ties: or mich

Sign Rail North 0.79 8" Hard Maple S 42°E 16.63' S 24°W 7" Hard Maple 15 84 6" Hard Maple S 52°W 23.77' (MSHD - replaced nail) 16" Hard Maple N 82°W 32.90

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by

Surveyor's Michigan License No. 37273

JOSEPH

DOMITROVICH

LAND SURVEYOR