

MAR 02 2001

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Ontonagon County Located in: Corner Code #

1. Public Land Survey T51N R38W G - 8
T R
T R
T R

2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. , Recorded Plat
5. Private Claims

JUDITH D. ROEHM 1P
Ontonagon County
Page 1 of 1 LC 5/353
JEM Date 12/08/2000 Time 11:40:11
RECORDING FEE: 9.00

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Joseph C. Domitrovich, in a field survey on November 8, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:

(G - 8) ¼ Corner Common to Sections 21 & 22, T51N, R38W.

1846 - H. & S.W. Higgins set a post with ties:

10" Elm N 52°W 40 links
14" Y. Birch S 50°E 50 links

I found no record of subsequent restoration.

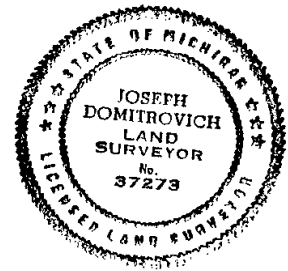

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no evidence of original corner or accessories. At the corner position I found the rotted base and point of a wood post. It was S 32°W 23 links from a fallen hardwood with a Copper Range Location poster (As called for on Poster). This position works well with GLO distances to Section Corners North and South. I have accepted it as the best representation of the original corner position.

Research on file with County Remonumentation Representative.

PEER GROUP APPROVED
Earl W. [Signature]
COUNTY SURVEYOR

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: 11-29-00

Corner is a 2 ½" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T51N, R38W; S. 21, S. 22; ¼; 2000; P.S. 37273. Ties:

4" Ash	S 15°E	12.38'	
4" Ash	N 63°W	9.02'	
5" Ash	N 15°E	9.64	
Fallen Hardwood	N 32°E	15.2'	(Ex. Copper Range Location Poster)
Steel Sign Rail	East	0.72'	(to face)
NE Cor. Sec. 21	N 02°40'19"W	2644.80'	
SE Cor. Sec. 21	S 02°43'08"E	2645.41'	

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted. Bearings shown between corners are on assumed basis, for reference only.

Signed by *[Signature]*

Date 11/28/00

Surveyor's Michigan License No. 37273