9.00

Ontonason County

## LAND CORNER RECORDATION CERTIFICATE 1 Filing Requirement of Act 74, Mich. P. AE 1970 = 07/10/2000 RECORDING FEE:

LC 5/320 Time 12:13:40

For corners in

Ontonagon County Located in: Comer Code # 1. Public Land Survey T52N **R39W** T52N **R38W** T R 2. Property Controlling R S T R in Section S T Miscellaneous S T R Property in Sec.

**SURVEY &** REMONUMENTATION

MAR 02 2001


SECTION

Register of Deeds Stamp & File Number

Lot No. , Recorded Plat Private Claims

I, Joseph C. Domitrovich, in a field survey on June 16, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

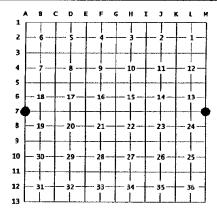

A. Description of original monument and accessories and/or subsequent restoration:

(M - 7/A - 7) Corner Common to Sections 13 & 24, T52N, R39W, and Sections 18 & 19, T52N, R38W,

1845 - William A. Burt set Hemlock post with ties:

12" Yellow Birch 14" Hemlock

N 42°E N 07°W

10 links 22 links

1846 - Sylvester W. Higgins added 2 B.T.s:

24" Sugar 14" Y. Birch S 40°F N 42°E 21 links 10 links

B. Description of comer evidence found and/or method applied in restoring or reestablishing comer:

At the corner position I found a 3/" O.D. x 36" iron pipe. Distances from this pipe work well with recovered remains of 2 of the original bearing trees. The first is Burt's 12" Y. Birch which is now rotten to ground level with roots remaining. The second is Higgins' 24" Sugar which is now a large rotted stump. Distances from this pipe to corners North, South and West work well with GLO. I replaced the pipe with a County Monument.

Research on file with County Remonumentation Representative.

COURTY

C. Description of monument for comer and accessories established to perpetuate locating the position of the corner:

Corner is a 2 1/2" x 30" Aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W, R38W; S. 18, S. 19, S. 13, S. 24; 2000; P.S. 37273. Corner falls on a point on a ravine with land sloping to North and West. Ties: OF BICHIES

7" Hard Maple	N 17°E	5.80'
14" Hard Maple	\$ 75°E	15.53'
12" Yellow Birch	S 07°E	13.48'
Steel Sign Rail	South	13.48' <b>3</b> 3 4 5 0.68'
10" Hard Maple	S 61°W	9.35'
E 1/4 Cor. Sec. 13	N 00°35'29"W	2646.98' (2640' GLO) 👢
E 1/4 Cor. Sec. 24	\$ 00°22'09"W	2641.50' (2640' GLO)
NW Cor. Sec. 24	S 89°45'54"W	5245.12' (5264.16' GLO)

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Surveyor's Michigan License No. 37273

JOSEPH DOMITROVICH LAND SURVEYOR

LAND