JUDITH D. ROEIM

Ontonsson County

U.5/238

LAND CORNER RECORDATION CERTIFICATE 10 37-1999 Tipo laissial Filing Requirement of Act 74, Mich. P.A. 1970 HAG FEE:

For corners in

Corner Code # Located In: ONTONAGON COCEBIC T48NR 41W 1. Public Land Survey T47NR 41W 2. Property Controlling in Section 3. Miscellaneous Property in Sec.

SURVEY & REMONUMENTATION

MAR 23 2000

SECTION


Register of Deeds Stamp & File Number

, Recorded Plat 4. Lot No. 5. Private Claims

1 Corner common to Sections 4 & 33, T47-48N, R41W.

Earl W. Applekamp, in a field survey on Oct. 01, 19, 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the limited States Description of the Interior. conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan that the Court of Law, established, re-established, monumented, Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

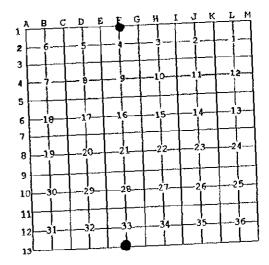

A. Description of original monument and accessories and/or subsequent restoration;

Original corner established by William A. Burt, U.S. Deputy Surveyor in 1847. Set Cedar Post.

ORIGINAL BEARING TREES:

NO4°E 20" Hemlock N60°W 12" Sugar

23 Links (15.18 feet) 18 Links (11.88 feet) DREE GROUP APPROVED W Goplikano

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No original evidence was found. The SEI of Section 33 has been farmed for 60 + years. A fence was found running North and South 75 feet East of the calculated corner position. This fence was installed about 30 years ago by the present owner. Checking the fence I mile North there is an obvious deflection to the East. I met with the owner of the SE‡ and pointed this out to him. Corner was re-established about 75 feet West of the existing fence line. Corner was set by single proportionate measure and on the Town Line between the monumented South 1 Corner of Section 32 and the Southeast Corner of Section 33.

Research on file with the Ontonagon County Remonumentation Program Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set a $2\frac{1}{2}$ "x30" split base aluminum pipe with a 3" cap stamped to read: County Remonumentation, T48N, T47N, R41W, S4, S33, 1, 1999, P.S. 17610. I established three bearing trees and a reference object.

56.14' - Nail in 10" White Birch S81°E 78.51'
74.23' - 6' Steel Sign Post South 0.66' N76°W Nail in 7" Aspen Nail in 16" Aspen N03°E

tast W Spolekamp 17610 Surveyor's Michigan License No.

Dale October 4, 1999

No. 17610 POFESSION

PROFESSIONAL