

85

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Schoolcraft
(County)

Located in:

Corner Code #

1. Public Land Survey

T 47N R 14W D11

T R

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

May 13 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:
(D11) Quarter corner common to Sections 29-32. Original corner location perpetuated in 1953 by Dean C. DeLaMater from original B.T. in good condition. Description of Corner Monument: 1" pipe with 4" brass cap. Witnesses to corner: 24" W. pine stump N74E 38 links, 14" W. pine stump S62W 51 links. Original record by Geo. Adair, 1851 for this corner shows B.T. Y. Pine 18 N74W 42 links, Y. Pine 24 S10E 17 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(D11) The 1953 monument was not recovered. Remonumented the corner at the original position as determined by subsurface evidence of the 1953 monument and at the record bearing and distance from the 1953 W. Pine stump N74E, and from the remains of the original Y. Pine B.T. S10E, now a stump with measuring notch visible. The 1953 W. Pine stump S62W has been destroyed by road construction. At the position for the corner, I placed a 1" 10 x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T. Stark and D. Lampela, Newberry District Office. A trail road is about 35' west of the corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(D11) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails
in the following:

4" J. Pine N08W 38.05' 1/4S NBT
6" J. Pine N50E 46.05' 1/4S NBT
5" R. Pine S49E 38.45' 1/4S NBT
7" R. Pine S54W 65.4' 1/4S NBT

Placed a 5" squared and scribed cedar post adjacent. Bearings are magnetic.

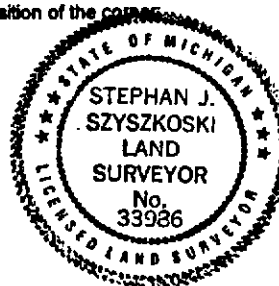

Signed by

Stephan J. Szyszkoski

Date

3/25/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division