

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located In:

Corner Code #

1. Public Land Survey	T <u>41N</u>	R <u>29W</u>	<u>J11</u>
	T _____	R _____	_____
	T _____	R _____	_____
	T _____	R _____	_____
2. Property Controlling In Section	S _____	T _____	R _____
	S _____	T _____	R _____
3. Miscellaneous Property in Sec.	S _____	T _____	R _____
	S _____	T _____	R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Jun 16 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:
(J11) Quarter corner common to Sections 26-35. Established in 1849 by John Burt: "West corrected [between Sects 26 & 35]...39.95 set Y. Birch Sect. post. Cedar 10 N14E 40, do 8 S70W 27".

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(J11) Recovered the remains of the original post and accessories as follows: The post was recovered as a column of rotting wood the lower end shaped to a point. At record bearing and distance SW from the post, recovered a 16" living cedar with old blazes, which, when opened, revealed the original face scribed "1/4S" as well as pencil marks dated May 28th 1905, "H. Higgins", and vague markings seeming to be the year "1897". Markings which appear to be another name were found but were not legible. Also at record bearing and distance from the post is the rotted remains of the original NE cedar bearing tree, no markings visible, in advanced decay, with another cedar growing from the remains. I accept the post as the original corner post and, in it's place, set a 1"ID x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Saraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(J11) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

The original 87 cedar 16" S6BN 17.8'

found scribed "1/4S"

11" Cedar S60E 29.2' "1/4S NBT"

18" Y. Birch S10E 28.6' do

14" Cedar S23W 8.6' do


7" Cedar N17W 20.3' do

Placed a squared cedar post adjacent.

Bearings are magnetic. Distances are to notch in lower blaze.

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 3/30/99

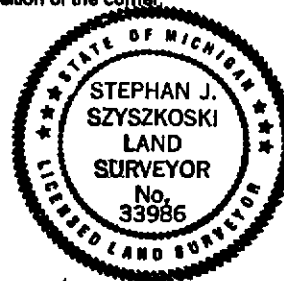

For the Michigan Department of Natural Resources - Forest Management Division