

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
Marquette  
(County)

	Located In:	Corner Code #/
1. Public Land Survey	T 45M R 26W	E3
	T _____ R _____	E4
	T _____ R _____	
	T _____ R _____	
2. Property Controlling in Section	S 8 T _____ R _____	7
	S _____ T _____ R _____	14
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Keith Sackett, in a field survey on April 9, 1991, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

E3	E4	7	14
Northeast corner of section 8. Wood post, 1852. M.M. Hall, D.S. Yellow pine 30 S37W 29 Lks. DO 28 N32E, SO Lks. Monument and accessories not found.	Quarter corner common to Sections 8 and 9. Wood post, 1852. M.M. Hall, D.S. Fir 12 N56W 15 Lks, white pine 30 S45E 5 Lks. Monument and accessories not found.	North one-sixteenth corner common to Sections 8 and 9. Not set on original survey nor subsequently, apparently.	South one-sixteenth corner common to Sections 8 and 9. Not set on original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

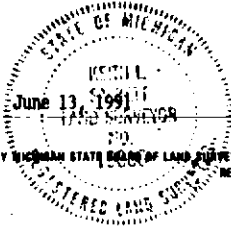
E3	E4	7	14
Restored by double proportionate measure between northeast corner of section 5, the northeast corner of section 9, the southeast corner of Section 8 and the northwest corner of Section 8.	Restored midway and on line.	Restored midway and on line.	Restored midway and on line.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E3	E4	7	14
DNR monument. 4" spruce N83E 31.9' 10" jack pine S56E 111.7" 6" spruce S24W 58.9' 5" cherry N29W 39.6'	1" pipe with plastic cap. 6" spruce N68E 26.1' 7" tamarack S06E 49.8' 4" spruce S25W 57.0' 5" spruce N15W 43.2'	DNR monument 5 1/2' long. 4" spruce N16E 17.0' 4" spruce N03W 25.4' 14" tamarack S74W 30.7' Squared wood post S70E 2.0'	DNR monument. 16" white pine N21E 43.8' 20" white pine S12E 47.7' 20" white pine S24W 43.7' 9" white pine N69W 35.1'

Signed by Keith S. Sackett Date \_\_\_\_\_

Surveyor's Michigan License No. 19006

  
 FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 29, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN., 1983